



VOLVO V40: 1FWY132

Vinnumber:	VV1MV8481D2006570	Versionname:	V40 D2 Base 115PK
First Registrationdate:	22/11/2013	Fiscalpower:	
Expertise Mileage:	77561	Power Kw:	84
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4808
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3738,03
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Seat cover F R, Stain, Cleaning	25,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F L, Stain, Cleaning 25,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Rear window, Scratch(es), E - Replace 370,00



Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper cover R M, Scratch(es), Smart repair

110,64





Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Chemical pollution, LI - Repair and paint (complete) 308,20



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display


Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08

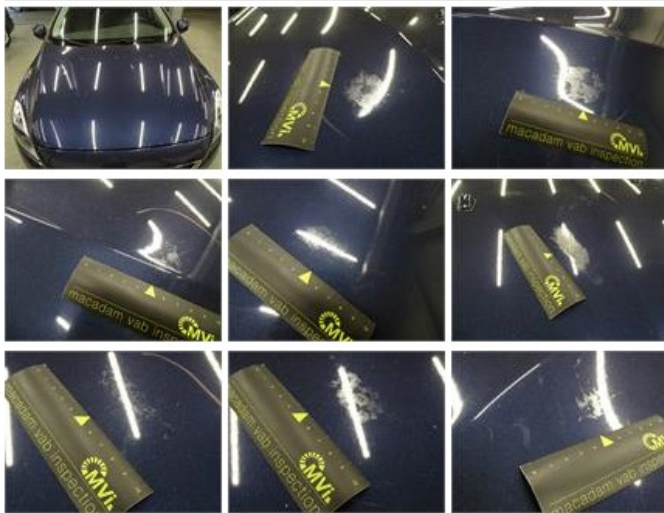

Floor covering F L, Hole, E - Replace

252,00



Rear spoiler, Chemical polution, LI - Repair and paint (complete)

115,56



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



