


OPEL ZAFIRA TOURER: 1KKD862

Vinnumber:	WOLPD9E32F1050295	Versionname:	1.6 CDTI ECOFLEX 100KW S/S EDITION
First Registrationdate:	19/05/2015	Fiscalpower:	
Expertise Mileage:	117253	Power Kw:	100
Bodytype:	MPV	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3214
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Cruise Control		Type of Tow bar	Tow bar removable
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Dunlop: 7 mm	Re.R.	Dunlop: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3215,82
-------------------	---------

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)	115,56
--	--------



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35





Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

301,68



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35



Floor covering F L, Hole, E - Replace

252,00



Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18



Instruction book, Missing, E - Replace

0,00

No pictures to display


Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80

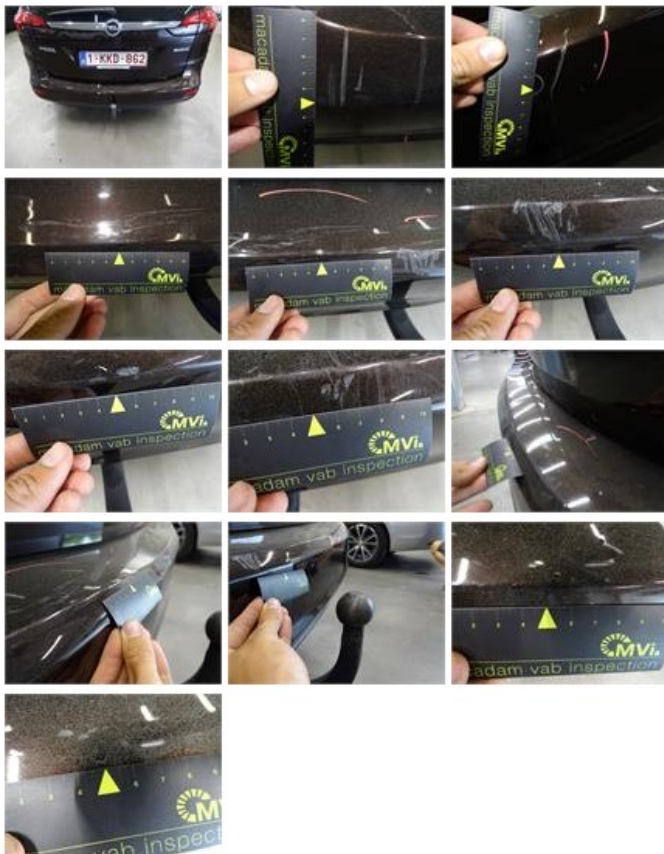

Trunk lid covering R, Scratch(es), Smart repair

110,64



Maintenance book, Missing, E - Replace

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80





Roof, Chemical polution, Acceptable

0,00

No pictures to display