



NISSAN QASHQAI: 1JHS180

Vinnumber:	SJNFAAJ11U1228387	Versionname:	1.5 DCI TEKNA
First Registrationdate:	23/12/2014	Fiscalpower:	
Expertise Mileage:	90638	Power Kw:	81
Bodytype:	SUV	Body color:	Burgundy
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1413
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/19/92 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 3175,89

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar R, Hail damage, PDR - Hail 0,00



Roof pillar L, Hail damage, PDR - Hail

150,00




Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35

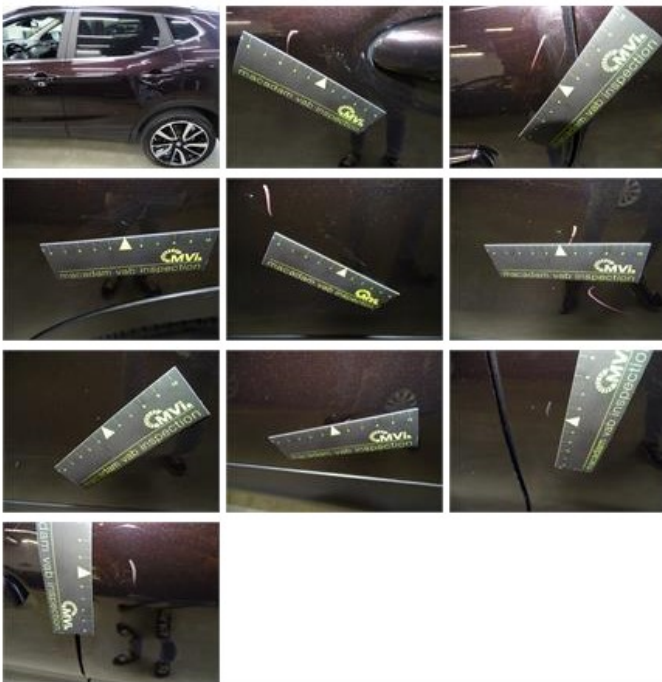

Sill trim R R, Scratch(es), Smart repair

110,64





Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Door panel R R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Bonnet, Hail damage, Le - Replace and paint 0,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Rear spoiler, Hail damage, LI - Repair and paint (complete) 115,56





Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Sill trim R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper cover R M, Dent(s) and scratch(es), Smart repair 110,64



Floor covering F L, Hole, E - Replace 252,00



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56



Door panel R L, Scratch(es), Smart repair 110,64



Bumper F M, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Hail damage, PDR - Hail 0,00



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68





Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Trunk lid covering R, Scratch(es), Smart repair

110,64



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56

