
BMW 1: 1GXX932

Vinnumber:	WBA1C91020P691647	Versionname:	1 HATCH 116d Eff.Dyn.Ed. 116PK
First Registrationdate:	2/06/2014	Fiscalpower:	
Expertise Mileage:	125617	Power Kw:	85
Bodytype:	Hatchback	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2720
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Uniroyal: 7 mm	Re.R.	Uniroyal: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1374,92
Wheel cover R L, Deformed / Strained, E - Replace	30,00




Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Wheel cover F R, Deformed / Strained, E - Replace




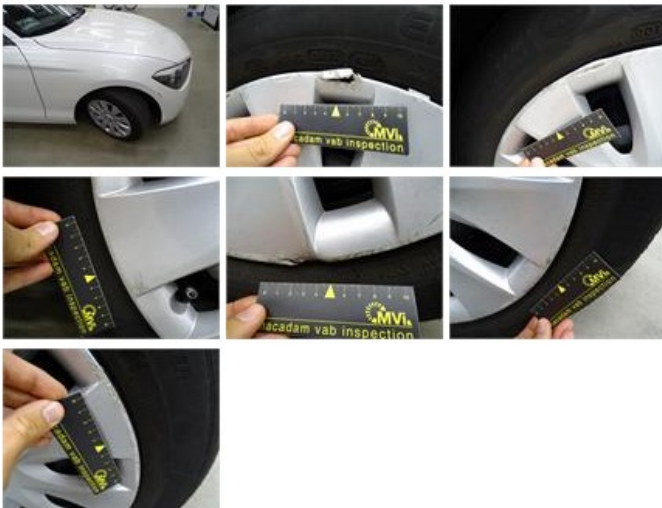

30,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

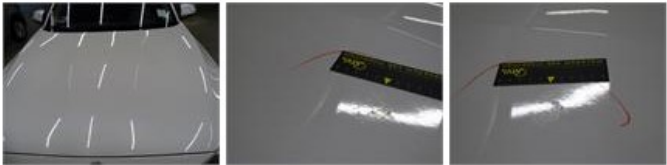211,80



Door R L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door panel R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
	
Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover F L, Scratch(es), E - Replace	30,00
	
Wing F R, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Dent(s), PDR - Paintless dent repair	122,40
	
Tailgate, Bad repair, Acceptable	0,00
	
Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
	
Wheel cover R R, Scratch(es), E - Replace	30,00



Door R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door panel F L, Tear, Smart repair	110,64
------------------------------------	--------

