



CITROEN GRAND C4 PICASSO: 1JLY724

Vinnumber:	VF73A9HC8EJ862952	Versionname:	1.6 E-HDI 115 MAN6 BUSINESS GPS
First Registrationdate:	20/01/2015	Fiscalpower:	
Expertise Mileage:	153712	Power Kw:	85
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Goodyear: 7 mm	Re.R.	Goodyear: 7 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	4079,16
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	211,80

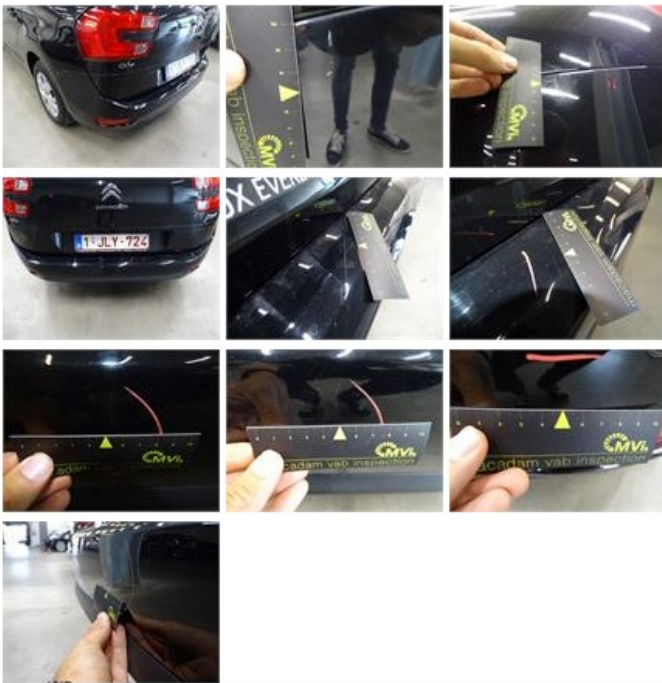


Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

268,18

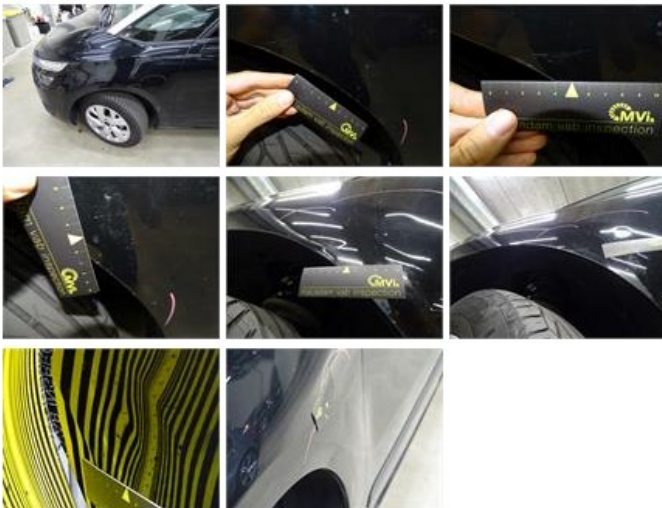

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00




Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

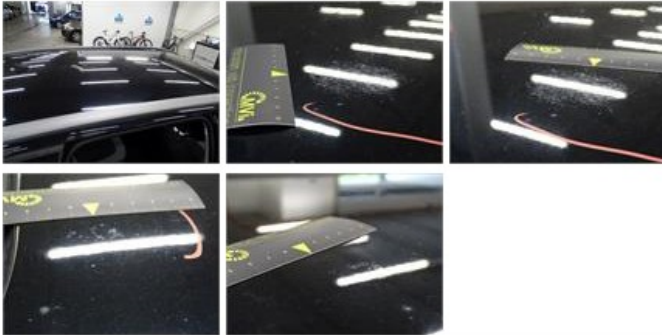

Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68



Sill outer R, Scratch(es), LI - Repair and paint (complete) 310,50



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Shutter / cover, Missing, E - Replace

10,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Floor covering R, Damaged, Smart repair

64,32




Rocker panel inner R L, Scratch(es), Acceptable

0,00

No pictures to display

Windscreen, Stone chip(s), E - Replace

487,20

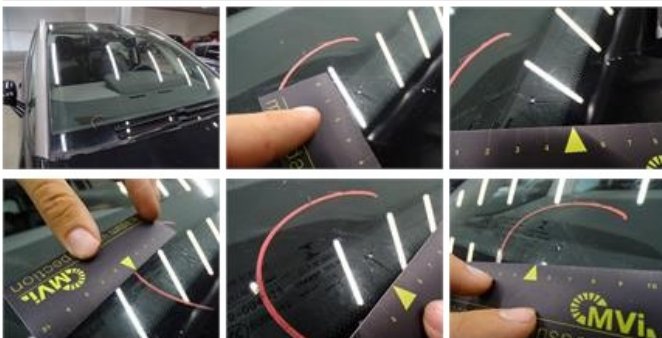

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Protection plate M, Deformed / Strained, E - Replace	74,00
--	-------



Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Door R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wheel hub cap R R, Missing, E - Replace	20,00
---	-------

