



MINI COUNTRYMAN: 1PAG317

Vinnumber:	WMWZD31010WS31754	Versionname:	1.6 COOPER D
First Registrationdate:	20/05/2016	Fiscalpower:	
Expertise Mileage:	55311	Power Kw:	82
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1E VERDIEP STEENTJES
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2543,71
Bumper cover R M, Dent(s) and scratch(es), Smart repair	110,64



Roof, Chemical polution, LI - Repair and paint (complete) 0,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80




Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Bonnet, Chemical polution, LI - Repair and paint (complete) 314,08

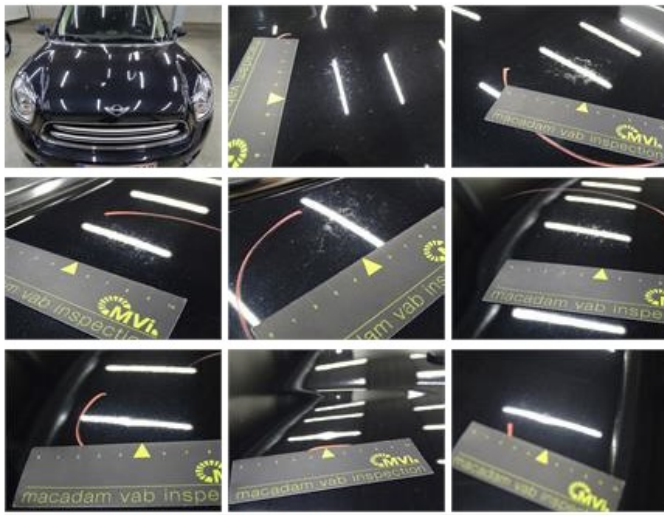

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display


Roof pillar R, Chemical polution, LI - Repair and paint (complete) 220,18




Roof pillar L, Chemical polution, 67 - Polish 0,00

No pictures to display

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

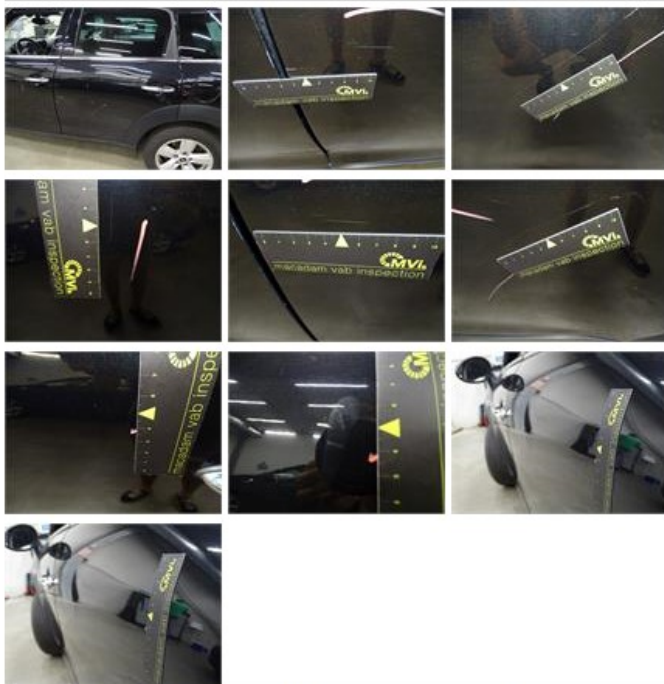


Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

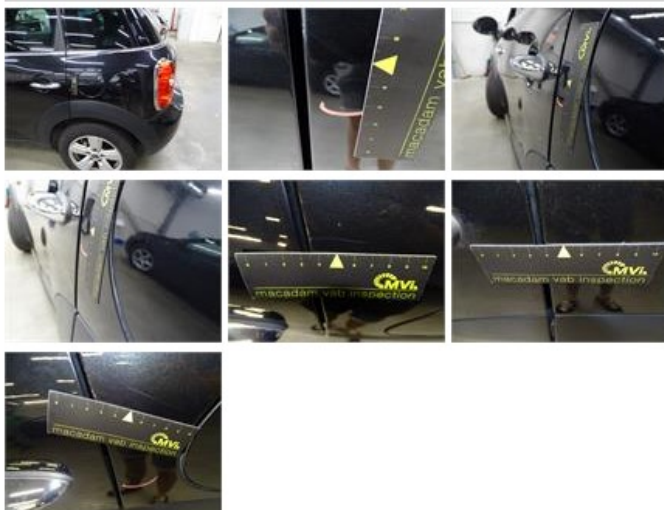

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete) 318,35

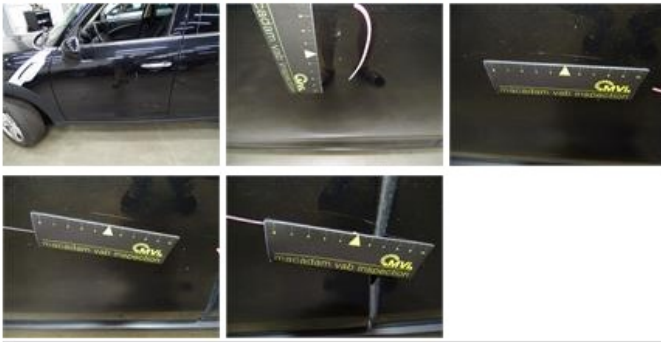

Door R R, Chemical polution, LI - Repair and paint (complete) 318,35



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

