


**MINI Mini: 1GUL227**

Vinnumber:	<b>WMWXM51030T902703</b>	Versionname:	<b>MINI BER Cooper 136PK</b>
First Registrationdate:	<b>5/05/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>67102</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Petrol</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3725</b>
Number of doors:	<b>3</b>		
Number of seats:	<b>4</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage		Sun Roof electric	
GPS storage	<b>HD</b>	Panoramic roof	
Windows electric F		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining semi-leather</b>		
Type of climate control	<b>Autom climate control</b>		
Head-up Display			

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/55/16/87 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Bridgestone: 3 mm</b>	Fr.R.	<b>Bridgestone: 3 mm</b>
	Re.L.	<b>Bridgestone: 7 mm</b>	Re.R.	<b>Bridgestone: 7 mm</b>

**Assistance equipment**

Repair kit	<b>No</b>	Compressor	<b>No</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>3890,25</b>
Tailgate, Scratch(es), LI - Repair and paint (complete)	<b>301,68</b>



Rear window, Scratch(es), Acceptable 0,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Gear shift lever knob, Worn, Acceptable 0,00



Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Seat cover F L, Worn, Acceptable 0,00





Tyre repair kit, Missing, E - Replace 210,53



Protection plate M, Hole, E - Replace 74,00




Wing trim R R, Deformed / Strained, E - Replace 84,00



Rear spoiler, Chemical polution, LI - Repair and paint (complete) 115,56



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

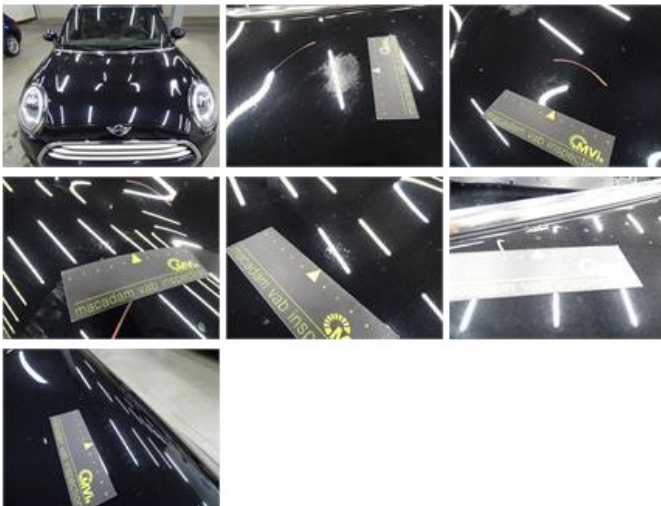

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper cover R M, Scratch(es), Acceptable 0,00

No pictures to display


Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Bumper R, Deformed / Strained, LI - Repair and paint (complete) 211,80

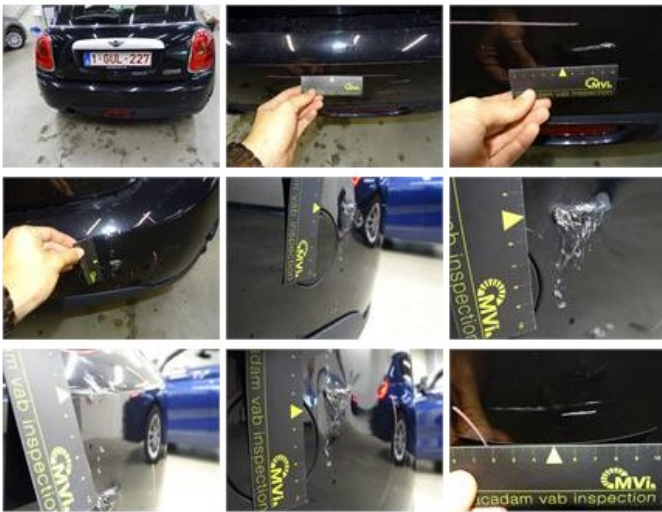

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00







Boot cover, Missing, E - Replace 50,00




Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

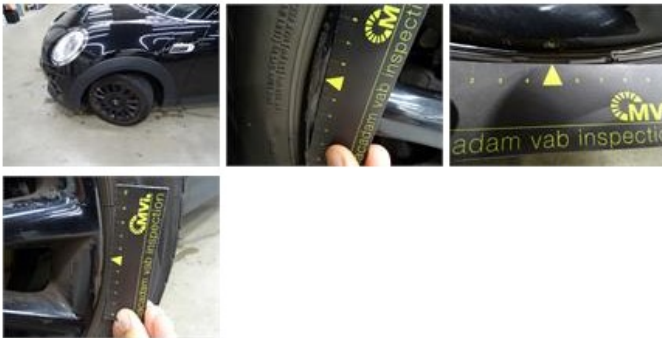

Roof, Scratch(es), LI - Repair and paint (complete) 481,50

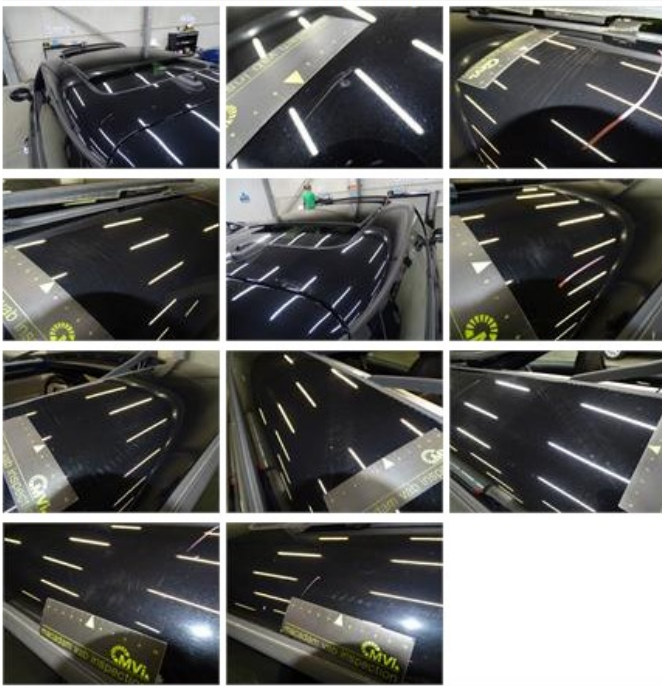

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

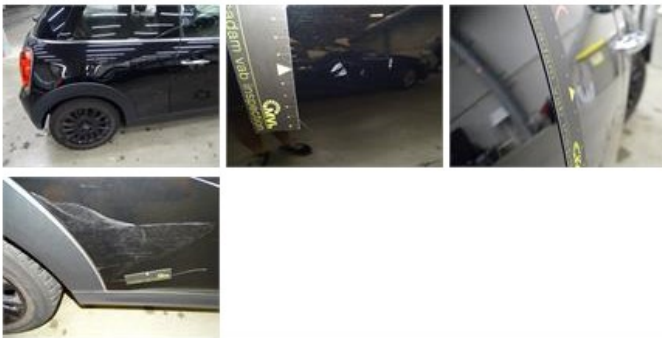

Compressor, Missing, E - Replace 0,00

