



BMW 3: 1HYB004

Vinnumber:	WBA3K11070F836247	Versionname:	3 TOURING 318d 136PK
First Registrationdate:	27/10/2014	Fiscalpower:	
Expertise Mileage:	177381	Power Kw:	100
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4305
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Panoramic roof	
GPS storage	HD	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 H LightMetal				
Winter tyres:	Fr.L.	Goodyear: 7 mm	Fr.R.	Goodyear: 7 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

Number of charging cables (normal)	0	Runflat	Yes
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1563,58
Wing R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Headrest F L, Worn, Acceptable	0,00



Wing R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Rear spoiler, Dent(s), Acceptable 0,00

No pictures to display

Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Door F L, Bad repair, Acceptable 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Dent(s), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68




Roof, Dent(s), PDR - Paintless dent repair

201,60



Door R L, Bad repair, Acceptable

0,00

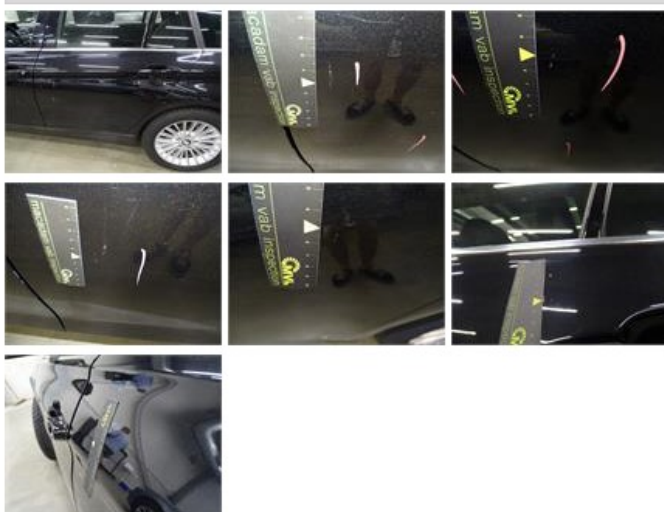

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

