


**FORD GRAND C-MAX: 1KFJ958**

Vinnumber:	<b>WF0HXXGCBHFK39103</b>	Versionname:	<b>1.6 TDCI</b>
First Registrationdate:	<b>21/04/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>68749</b>	Power Kw:	<b>85</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2128</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	<b>SD</b>	Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Manual climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>215/55/16/93 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	<b>1556,10</b>
Alloy rim R L, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Interior, Dirty, Chemical cleaning	<b>150,00</b>



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 307,80



Bumper moulding R, Deformed / Strained, E - Replace 14,40



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F R, Stain, Cleaning 25,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Mirror side blinker R, Scratch(es), Acceptable 0,00


No pictures to display

Bumper grille, Deformed / Strained, E - Replace 32,40



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



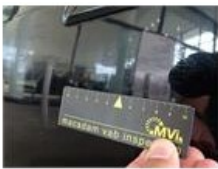

Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Maintenance book, Missing, E - Replace 0,00



Door panel F L, Worn, Acceptable 0,00

No pictures to display

Outer valance R, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover R R, Stain, Cleaning 25,00



Instruction book, Missing, E - Replace 0,00

No pictures to display