



VOLVO V60: 1PED904

Vinnumber:	YV1FW74C1H1332493	Versionname:	2.0 D2 KINETIC
First Registrationdate:	15/06/2016	Fiscalpower:	
Expertise Mileage:	126415	Power Kw:	88
Bodytype:	Break	Body color:	Light Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2114
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Rear parking sensors	
GPS storage	HD	Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/97 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Uniroyal: 7 mm	Re.R.	Uniroyal: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2695,49

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display


Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Door panel R L, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56

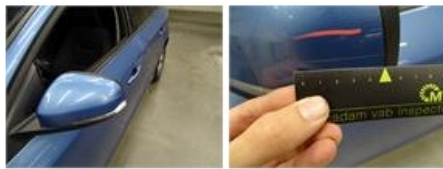


Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Double pedal, Not functioning (well), Repair/replace (lump sum) 20,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

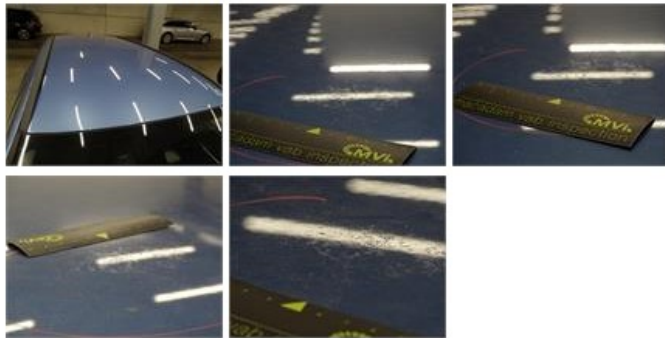

Door panel F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Luggage space cover, Missing, E - Replace 240,00




Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

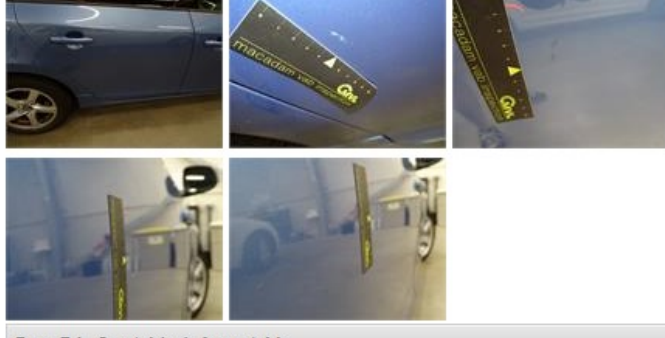

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20

