



VOLVO XC60: 1KSE018

Vinnumber:	VV1DZARC1G2799416	Versionname:	2.0 D3 2WD MOMENTUM
First Registrationdate:	22/06/2015	Fiscalpower:	
Expertise Mileage:	95844	Power Kw:	110
Bodytype:	SUV	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3311
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/17/104 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Pirelli: 3 mm	Re.R.	Pirelli: 3 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT	4028,17
Door panel R L, Hole, E - Replace	132,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display


Roof, Chemical polution, LI - Repair and paint (complete) 577,80

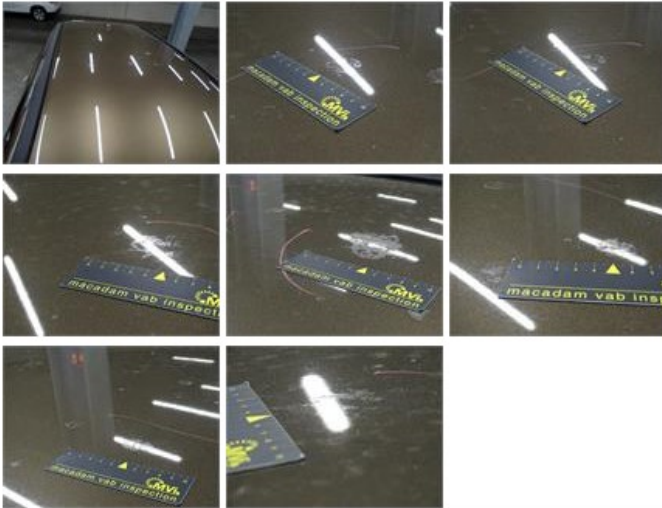

Wing R R, Scratch(es), LI - Repair and paint (complete) 369,84



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02

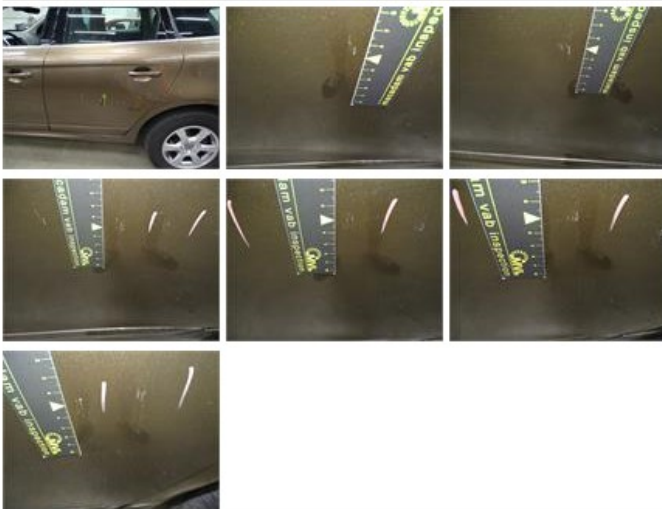


Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02





Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16

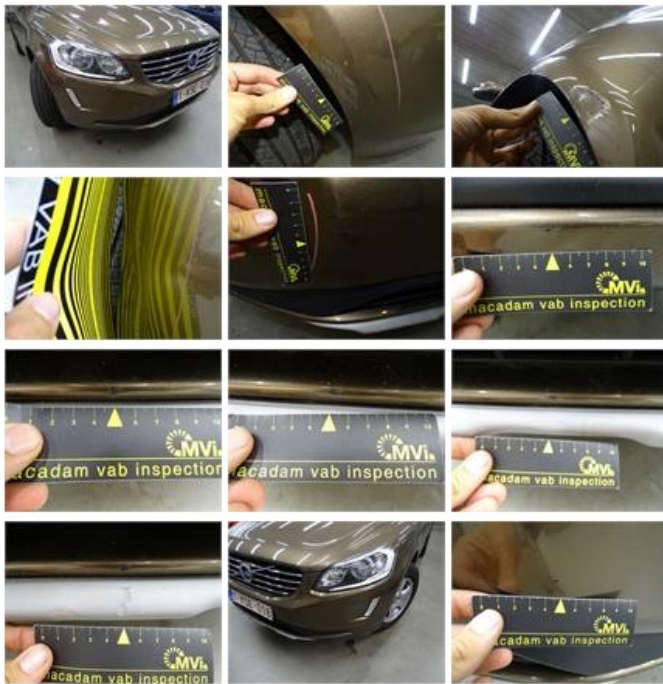

Door panel R R, Hole, E - Replace

132,00



Bonnet, Chemical polution, LI - Repair and paint (complete)

348,09



A-Pillar left, Bad repair, Acceptable

0,00



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Roof pillar L, Chemical polution, LI - Repair and paint (complete)

264,22





Bumper spoiler F, Scratch(es), E - Replace

48,00



Door panel F R, Hole, E - Replace

132,00



Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

369,84



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02

