



**FORD Transit 300S: XNC709**

Vinnumber:	<b>WF0XXXBDFX7E07033</b>	Versionname:	<b>TRANSIT B/F 300S SWB 110pk</b>
First Registrationdate:	<b>21/06/2007</b>	Fiscalpower:	
Expertise Mileage:	<b>87156</b>	Power Kw:	<b>81</b>
Bodytype:	<b>Transporter</b>	Body color:	<b>White</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Opaque</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>LCV20</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>3</b>		
Number head rests:	<b>3</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		

**Options**

Windows electric F	Central consol F
Radio multimedia	Type of Tow bar
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>No GPS</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Manual climate control</b>
	<b>No Tow bar</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>195/70/15/102 R Steel</b>				
Summer tyres:	Fr.L.	<b>Michelin: 3 mm</b>	Fr.R.	<b>Michelin: 3 mm</b>
	Re.L.	<b>Hankook: 6 mm</b>	Re.R.	<b>Hankook: 6 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT 4081,22

Trunk door R R, Dent(s) and scratch(es), It - Spot repair 115,56





Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer L, Scratch(es), LI - Repair and paint (complete) 232,88



Sidewall RR (LCV), Dent(s) and scratch(es), It - Spot repair 115,56



Floor covering F L, Hole, E - Replace 237,00



Roof, Dent(s) and scratch(es), LI - Repair and paint (complete) 433,13



Central pillar L, Rust, LI - Repair and paint (complete) 366,49



Wing F L, Dent(s) and scratch(es), Le - Replace and paint 427,51







Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76



Central pillar R, Rust, LI - Repair and paint (complete)

366,49



Sill outer R, Scratch(es), LI - Repair and paint (complete)

232,88



Wheel cover F L, Deformed / Strained, Acceptable

0,00

*No pictures to display*

Wing moulding F L, Dent(s) and scratch(es), Le - Replace and paint

75,00



Sidewall RL (LCV), Dent(s) and scratch(es), It - Spot repair


115,56



Tailgate lock, Strained , E - Replace 0,00



Bumper R, Scratch(es), Smart repair 110,64

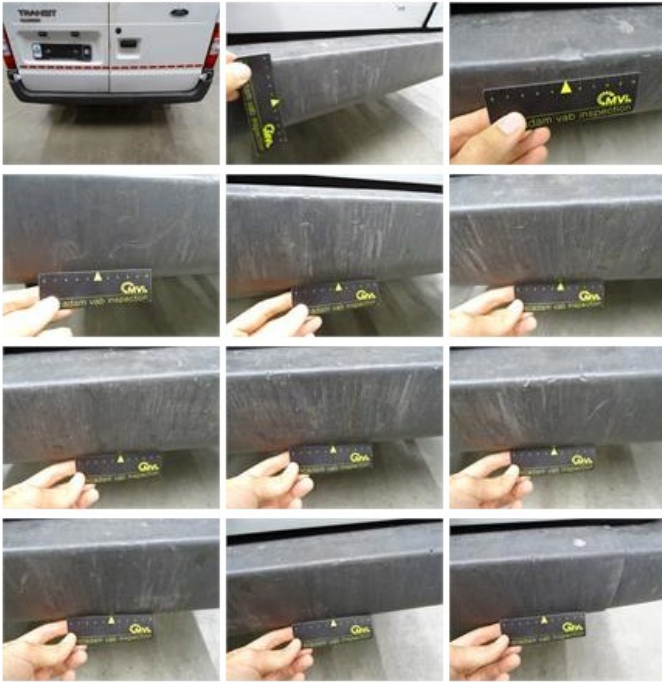


Wing F R, Scratch(es), Acceptable 0,00

*No pictures to display*

Internal Boot Lining R, Broken, E - Replace 64,00




Trunk door R L, Dent(s) and scratch(es), It - Spot repair 115,56

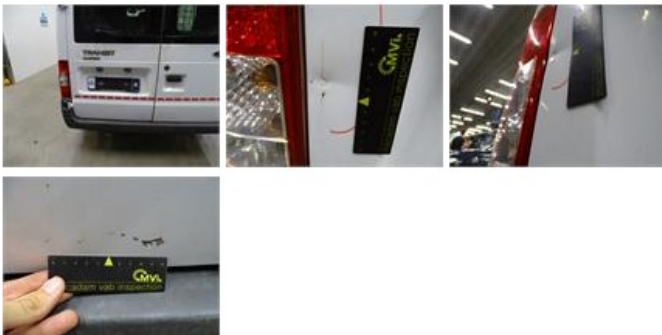

Rocker panel inner F R, Scratch(es), Acceptable 0,00

*No pictures to display*

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

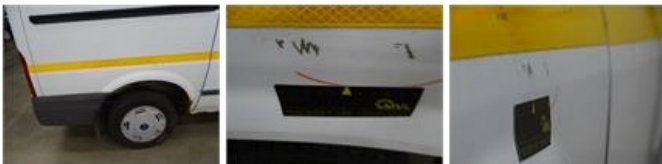



Wheel cover F R, Broken, E - Replace

22,50



Bumper F, Scratch(es), Smart repair

110,64



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76

