



SEAT LEON ST: 1SAP804

Vinnumber:	VSSZZZ5FZHR045467	Versionname:	1.0L TSI 85kW Style Ecomotive DSG
First Registrationdate:	27/03/2017	Fiscalpower:	
Expertise Mileage:	63080	Power Kw:	85
Bodytype:	Break	Body color:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3726
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/55/16/91 H LightMetal				
Winter tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2857,89
Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35

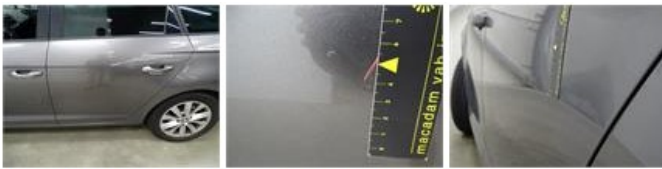

Roof, Chemical polution, LI - Repair and paint (complete)

0,00

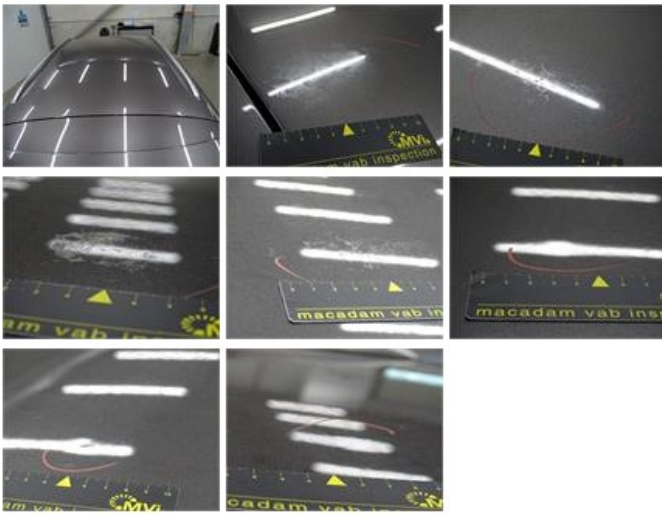

Trunk lid covering R, Scratch(es), Smart repair

110,64



Internal Boot Lining L, Scratch(es), Smart repair

110,64



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s), LI - Repair and paint (complete) 318,35



Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Boot carpet, Stain, Cleaning 25,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68





Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

338,08



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80





Outer door handle F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

