



CITROEN C4 Picasso: 1GWN828

Vinnumber:	VF73A9HC8EJ636979	Versionname:	GR.C4 PICASSO Business GPS 115PK
First Registrationdate:	20/05/2014	Fiscalpower:	
Expertise Mileage:	91175	Power Kw:	85
Bodytype:	MPV	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2724
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/60/16/92 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2929,99
Roof, Chemical polution, LI - Repair and paint (complete)	481,50

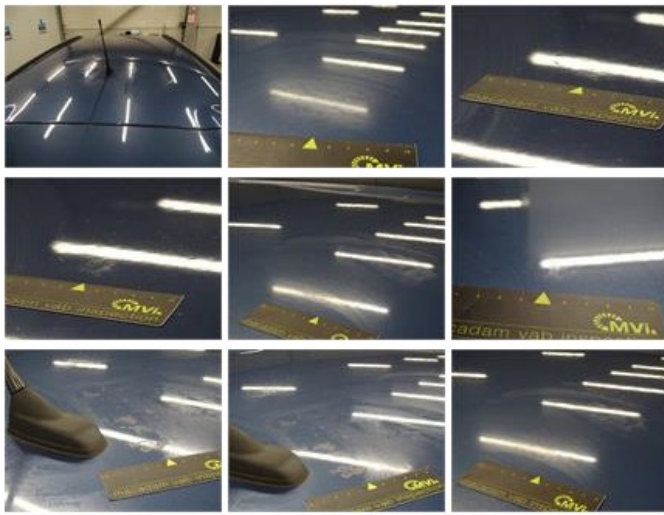

Bumper moulding F L, Scratch(es), E - Replace

14,40



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Mirror side blinker R, Broken, E - Replace

30,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00





Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

119,00



Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bumper moulding F R, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wheel hub cap F L, Missing, E - Replace

15,00

