



VOLKSWAGEN GOLF VII: 1KET267

Vinnumber:	WVWZZZAUZFP101861	Versionname:	1.6 TDI 77KW BMT TRENDLINE
First Registrationdate:	16/04/2015	Fiscalpower:	
Expertise Mileage:	33478	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1714
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

195/65/15/95 T Steel				
Summer tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Kleber: 5 mm	Re.R.	Kleber: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2405,92
Rear spoiler, Dent(s) and scratch(es), LI - Repair and paint (complete)	115,56

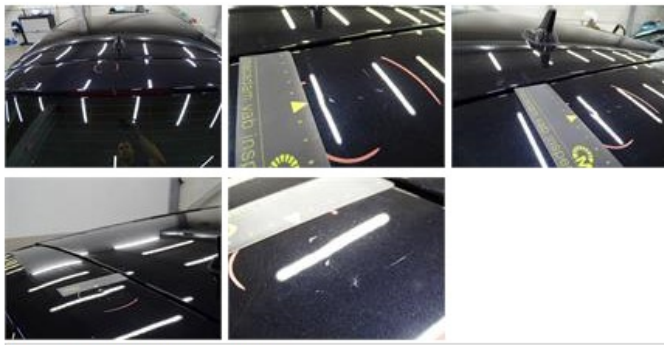

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80




Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50

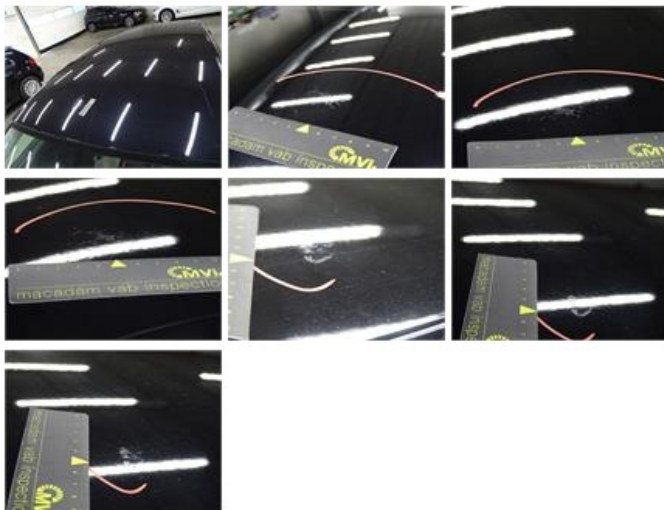

Wing R R, Bad repair, Acceptable 0,00




Roof pillar R, Chemical polution, Acceptable 0,00

No pictures to display

Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display


Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80

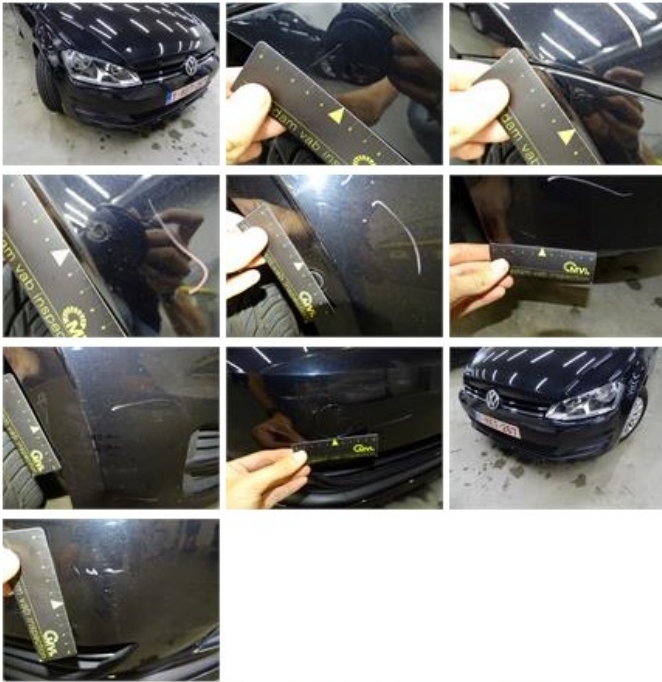

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

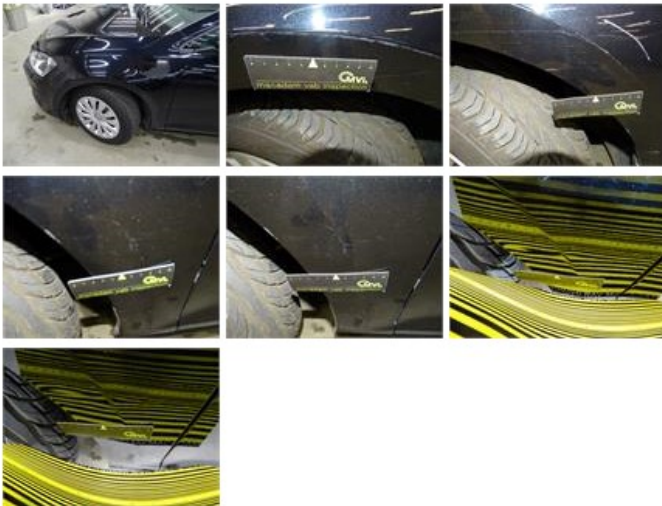


Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18

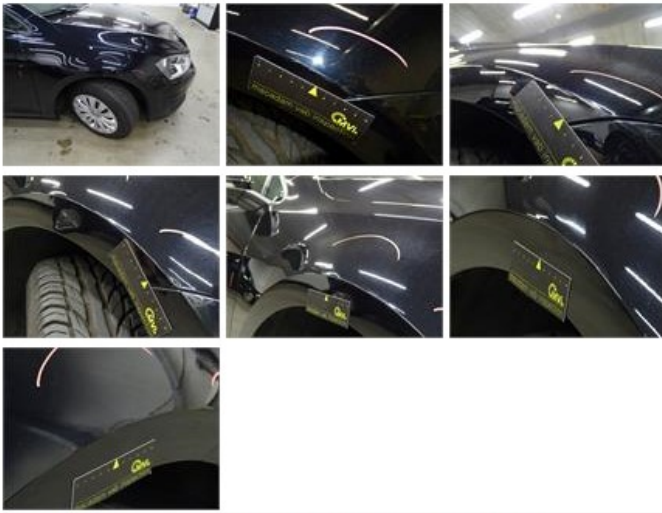

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Wheel cover R R, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Scratch(es), Acceptable

0,00

No pictures to display