


OPEL INSIGNIA SPORTS TOURER: 1KXV458

Vinnnummer:	WOLGT8E56F1096491	Versionname:	2.0 CDTI ECOFLEX 103KW S/S COSMO
First Registrationdate:	28/07/2015	Fiscalpower:	
Expertise Mileage:	164938	Power Kw:	103
Bodytype:	Break	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2819
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/101 Y LightMetal				
Summer tyres:	Fr.L.	Dunlop: 5 mm	Fr.R.	Dunlop: 5 mm
	Re.L.	Dunlop: 6 mm	Re.R.	Dunlop: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1703,90
Wing F R, Bad repair, Acceptable	0,00



Door R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Internal Boot Lining L, Tear, Smart repair 110,64



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80






Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Bumper F, Bad repair, Acceptable

0,00

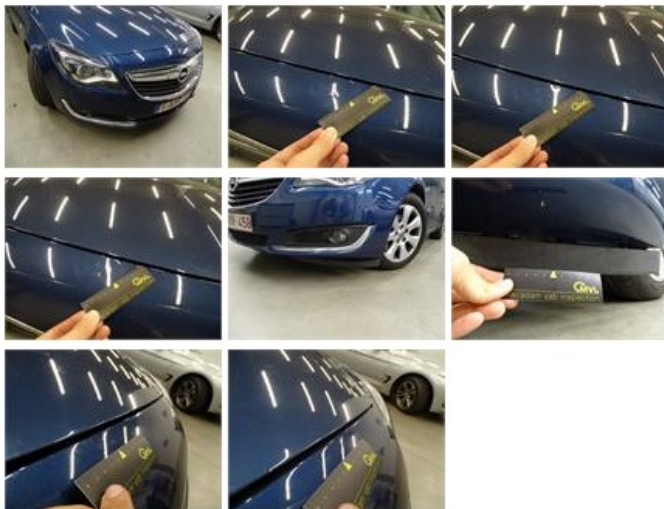

Wing R L, Dent(s), Acceptable

0,00

No pictures to display

Wing R R, Chemical polution, LI - Repair and paint (complete)

308,20



Rearview mirror housing L, Scratch(es), Acceptable

0,00

No pictures to display