


**RENAULT Laguna: 1HHZ094**

Vinnumber:	<b>VF1KT12C650265202</b>	Versionname:	<b>LAGUNA BRE Business 110PK</b>
First Registrationdate:	<b>21/02/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>74968</b>	Power Kw:	<b>81</b>
Bodytype:	<b>Break</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3326</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage	<b>SD</b>	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	<b>Tow bar removable</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining semi-artificial leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/60/16/92 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Kleber: 4 mm</b>	Fr.R.	<b>Kleber: 4 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	2892,12
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F L, Scratch(es), Acceptable

0,00

*No pictures to display*

Roof pillar R, Chemical polution, 67 - Polish

0,00

*No pictures to display*

Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Alloy rim R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Rear spoiler, Chemical polution, LI - Repair and paint (complete)

115,56



Sill outer R, Scratch(es), Acceptable

0,00

*No pictures to display*

Ignition key, Missing, E - Replace

150,00

*No pictures to display*

Wing F R, Scratch(es), Acceptable

0,00

*No pictures to display*

Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50



Wing F L, Chemical polution, LI - Repair and paint (complete)

220,18



Door R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Door F L, Scratch(es), Acceptable

0,00

*No pictures to display*

Wing R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Protection plate M, Deformed / Strained, E - Replace

74,00




Door F R, Chemical polution, LI - Repair and paint (complete)

318,35



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

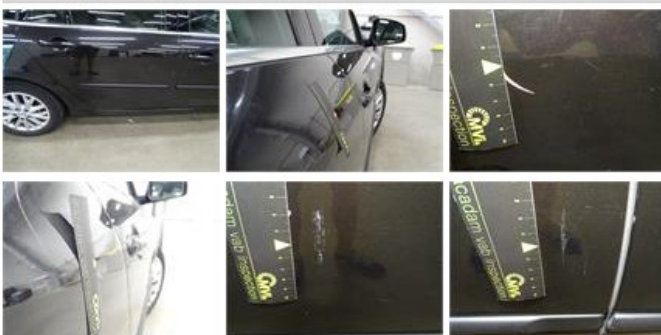



Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

