



**SKODA Octavia: 1HCR738**

Vinnumber:	<b>TMBJG7NE8F0020485</b>	Versionname:	<b>OCTAVIA COMBI Ambition DSG 105PK Aut.</b>
First Registrationdate:	<b>19/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>135019</b>	Power Kw:	<b>77</b>
Bodytype:	<b>Break</b>	Body color:	<b>Silver</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2725</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>SD</b>	Rear parking sensors	
Windows electric F		Type of Tow bar	<b>Tow bar fixed</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

	<b>205/55/16/91 H Steel</b>			
Winter tyres:	Fr.L.	<b>Goodyear: 5 mm</b>	Fr.R.	<b>Goodyear: 5 mm</b>
	Re.L.	<b>Goodyear: 5 mm</b>	Re.R.	<b>Goodyear: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

<b>Total cost ex VAT</b>	<b>2340,58</b>
<b>Wing F L, Scratch(es), Acceptable</b>	<b>0,00</b>
<i>No pictures to display</i>	
<b>Rear window, Scratch(es), E - Replace</b>	<b>370,00</b>

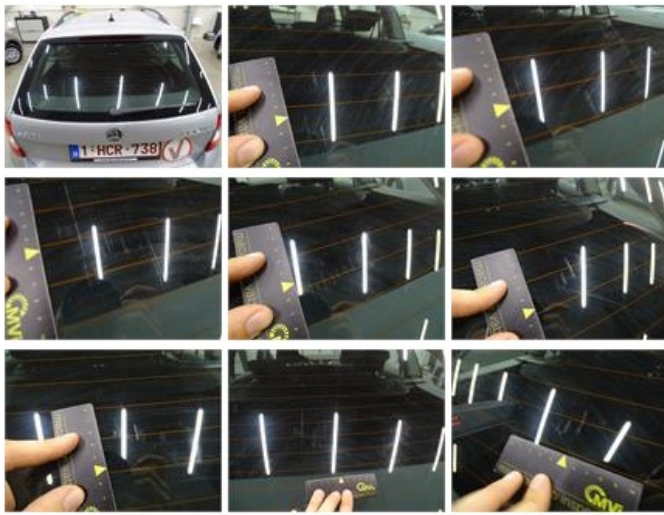

Door F L, Deformed / Strained, LI - Repair and paint (complete)

318,35



Door seal F L, Deformed / Strained, E - Replace

54,00



Wheel cover R L, Missing, E - Replace

30,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Tailgate, Bad repair, Acceptable

0,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Missing, E - Replace 30,00



Bumper F, Bad repair, Acceptable 0,00



Roof, Scratch(es), LI - Repair and paint (complete) 481,50



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F L, Missing, E - Replace 30,00



Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18







Seat cover F L, Worn, Acceptable

0,00



Windscreen, Stone chip(s), Acceptable

0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Wheel cover F R, Missing, E - Replace

30,00

