



VOLVO V60: 1KNU009

Vinnumber:	YV1FW78C0G1287420	Versionname:	2.0 D2 GEARTRONIC KINETIC
First Registrationdate:	4/06/2015	Fiscalpower:	
Expertise Mileage:	82357	Power Kw:	88
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2111
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	Tow bar removable
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/97 V LightMetal				
Summer tyres:	Fr.L.	Vredestein: 7 mm	Fr.R.	Vredestein: 7 mm
	Re.L.	Uniroyal: 8 mm	Re.R.	Uniroyal: 8 mm

Assistance equipment

Repair kit	No	Compressor	No
------------	-----------	------------	-----------

Total cost ex VAT 1601,92

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Interior, Dirty, Cleaning 50,00



Tyre repair kit, Missing, E - Replace 210,53




Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Sill trim R, Dent(s) and scratch(es), It - Spot repair 163,56

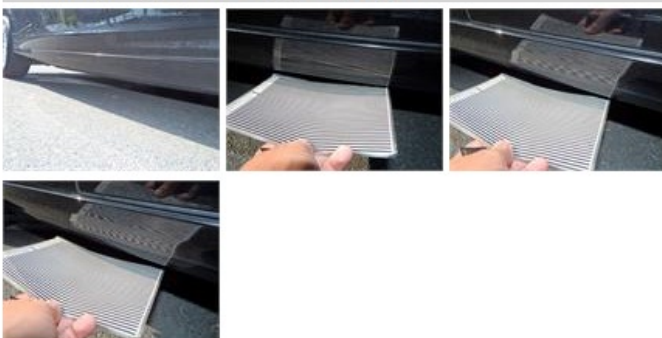

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door panel R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), It - Spot repair 115,56



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 366,35



Wing F R, Dent(s), It - Spot repair 115,56



Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F R, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), PDR - Paintless dent repair 63,00

