



FORD Grand C-Max: 1JHV058

Vinnumber:	WF0HXXGCBHEA52533	Versionname:	GR.C-MAX Trend St/St 95PK
First Registrationdate:	24/12/2014	Fiscalpower:	
Expertise Mileage:	77017	Power Kw:	70
Bodytype:		Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3719
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage		Rear parking sensors	
GPS storage	SD	Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/93 V LightMetal			
Summer tyres:	Fr.L. Goodyear: 4 mm	Fr.R. Goodyear: 4 mm	
	Re.L. Michelin: 5 mm	Re.R. Michelin: 5 mm	

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 1654,16

Seat cover R, Unclasped, Repair/replace (lump sum) 48,00



Sill R R, Broken, E - Replace

57,18



Door R L, Dent(s), PDR - Paintless dent repair

63,00



Door R R, Repaired, Acceptable

0,00

No pictures to display

Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door F L, Dent(s), LI - Repair and paint (complete)


318,35



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



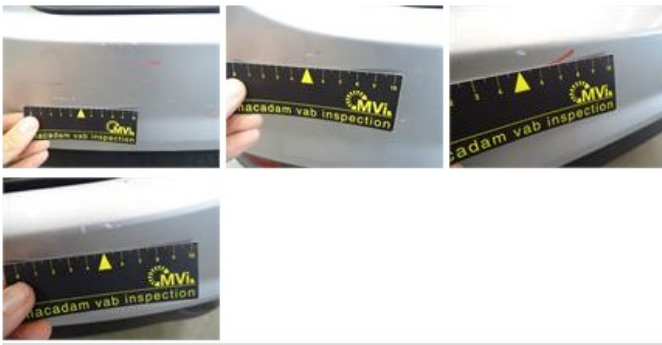

Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Bumper moulding F, Broken, E - Replace 14,40



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Luggage space cover, Scratch(es), Smart repair 110,64



Trunk lid covering R, Scratch(es), Smart repair 110,64



Bonnet, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

