



PEUGEOT 308 SW: 1KTJ988

Vinnumber:	VF3LCBHXHFS149228	Versionname:	1.6 BLUEHDI 85KW S/S 85G ACTIVE
First Registrationdate:	30/06/2015	Fiscalpower:	
Expertise Mileage:	144866	Power Kw:	85
Bodytype:	Break	Body color:	Purple
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1329
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2303,79
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Scratch(es), LI - Repair and paint (complete)	290,08

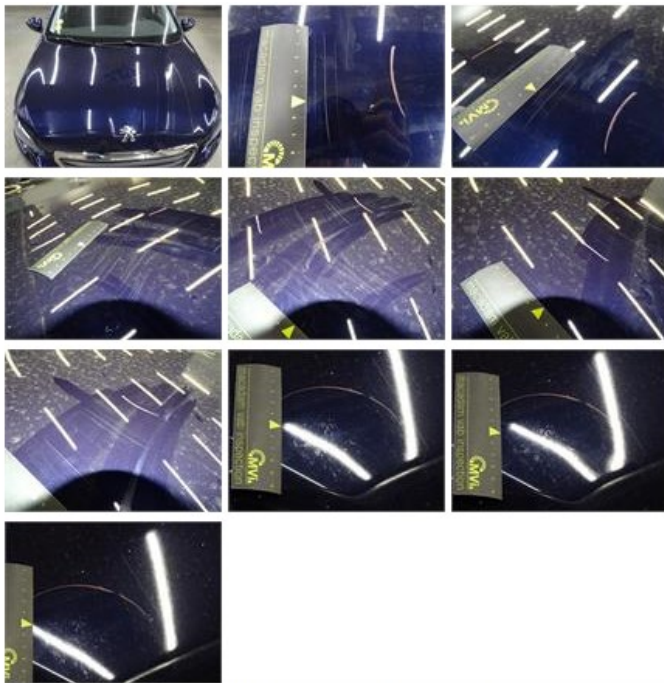

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R L, Chemical pollution, Acceptable

0,00



Floor covering F L, Hole, E - Replace

252,00



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)

115,56



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Rear spoiler, Dent(s), Acceptable 0,00

No pictures to display

Roof, Dent(s), PDR - Paintless dent repair 122,40



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Tailgate, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display


Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Chemical cleaning 25,00

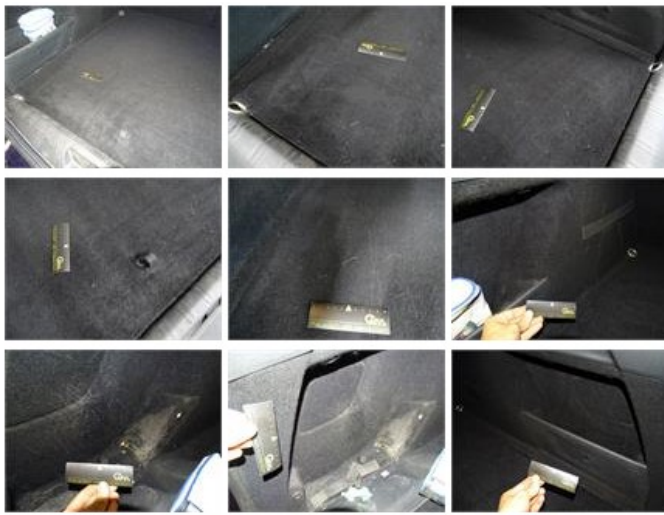

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Deformed / Strained, E - Replace 235,20



Alloy rim R R, Deformed / Strained, E - Replace 235,20



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

