



PEUGEOT 308 SW: 1LAH431

Vinnumber:	VF3LCBHXHFS200851	Versionname:	1.6 BLUEHDI 85KW S/S 88G ALLURE
First Registrationdate:	31/07/2015	Fiscalpower:	
Expertise Mileage:	55967	Power Kw:	85
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1712
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	4221,24
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Floor covering F L, Hole, E - Replace 252,00



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Door F L, Scratch(es), LI - Repair and paint (complete) 318,35





Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display


Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Rear window, Scratch(es), E - Replace 0,00

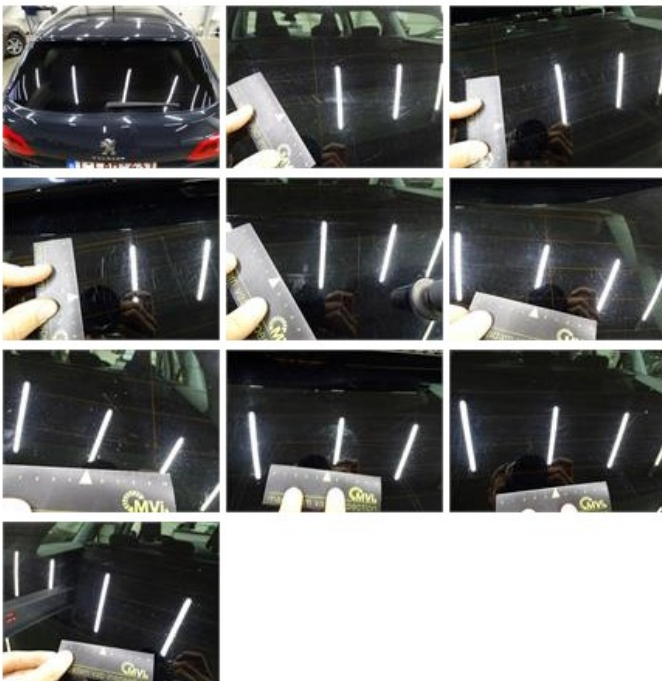

Rear spoiler, Chemical polution, LI - Repair and paint (complete) 115,56



Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00





Covering interior B pillar L, Scratch(es), Smart repair

110,64



Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18



Roof, Chemical pollution, LI - Repair and paint (complete)

481,50



Trunk lid covering R, Scratch(es), Smart repair


110,64






Bumper R, Scratch(es), LI - Repair and paint (complete)

0,00

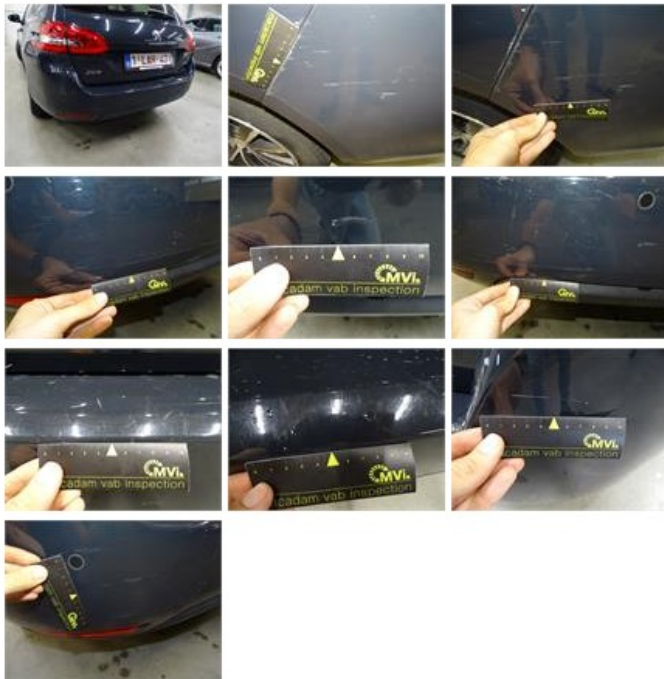

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00

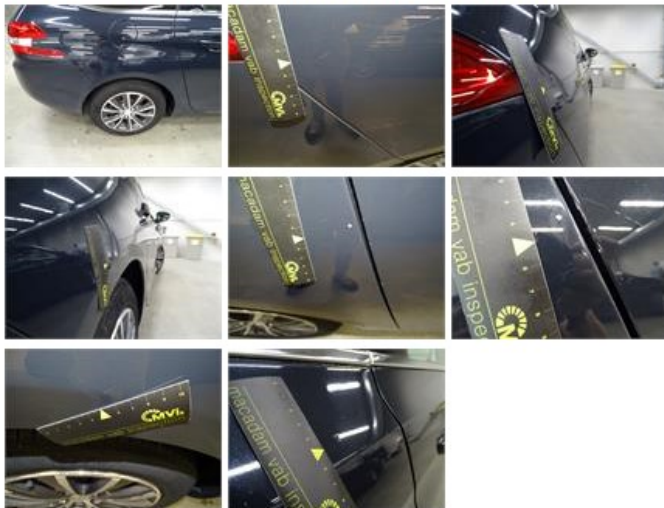

Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)

115,56



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Interior, Dirty, Cleaning

50,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



