



VOLVO V40: 1KUK351

Vinnumber:	VV1MV74L1G2283639	Versionname:	2.0 D2 VOLVO OCEAN RACE
First Registrationdate:	7/07/2015	Fiscalpower:	
Expertise Mileage:	135059	Power Kw:	88
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1208
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Manual climate control
Sport seats	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/50/17/93 W LightMetal			
Summer tyres:	Fr.L.	Pirelli: 6 mm	Fr.R.	Pirelli: 6 mm
	Re.L.	Semperit: 8 mm	Re.R.	Semperit: 8 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 3174,17

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Dent(s), LI - Repair and paint (complete) 318,35



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Door F L, Scratch(es), Acceptable 0,00
No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Scratch(es), Acceptable 0,00
No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00





Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Roof, Scratch(es), LI - Repair and paint (complete) 481,50




Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Scratch(es), LI - Repair and paint (complete) 290,08

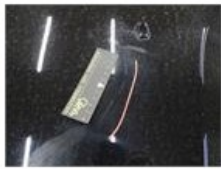

Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18

