



**VOLKSWAGEN Touran: 1HBV878**

Vinnnumber:	<b>WVGZZZ1TZEW097873</b>	Versionname:	<b>TOURAN Trendline BMT St&amp;St 7pl.105PK</b>
First Registrationdate:	<b>13/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>123788</b>	Power Kw:	<b>77</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3424</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>7</b>		
Number head rests:	<b>7</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

<b>205/55/16/91 T LightMetal</b>			
Winter tyres:	Fr.L.	Fr.R.	Michelin: 4 mm
	Re.L.	Re.R.	Michelin: 4 mm

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	1499,00
Tailgate, Hail damage, PDR - Hail	125,00

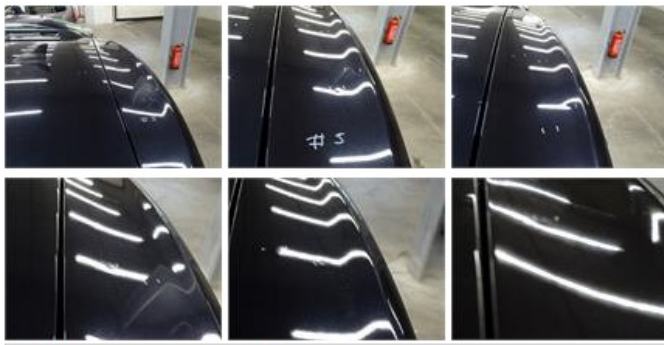

Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display


Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Hail damage, PDR - Hail 225,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

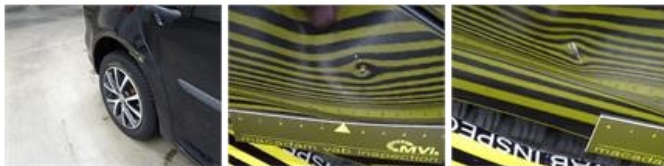

Roof pillar R, Hail damage, PDR - Hail 100,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar L, Hail damage, PDR - Hail 100,00



Door panel R L, Hole, E - Replace 114,00



Roof, Hail damage, PDR - Hail 125,00



Bumper F, Scratch(es), Acceptable 0,00

*No pictures to display*

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R R polished, Scratch(es), Acceptable 0,00

*No pictures to display*

Wing F R, Dent(s) and scratch(es), Acceptable 0,00

*No pictures to display*