



**BMW 4 GRAN COUPE: 1LBD561**

Vinnumber:	<b>WBA4E91050G390765</b>	Versionname:	<b>2.0 420D (120KW) GRAN COUPE</b>
First Registrationdate:	<b>7/08/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>103547</b>	Power Kw:	<b>120</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1707</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	<b>Tow bar fixed</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining artificial leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>225/50/17/94 W LightMetal</b>				
Summer tyres:	Fr.L.	<b>Bridgestone: 5 mm</b>	Fr.R.	<b>Bridgestone: 5 mm</b>
	Re.L.	<b>Continental: 6 mm</b>	Re.R.	<b>Continental: 6 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>395,96</b>
Bumper F, Scratch(es), LI - Repair and paint (complete)	<b>0,00</b>



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Bumper R, Scratch(es), LI - Repair and paint (complete) 0,00



Alloy rim F R, Scratch(es), Acceptable 0,00


No pictures to display

Door F L, Dent(s), PDR - Paintless dent repair 63,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 0,00



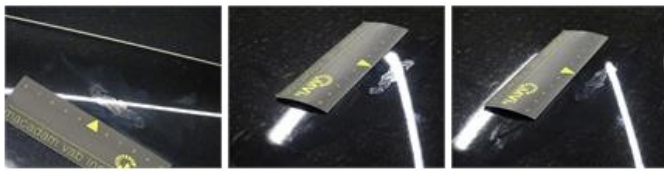

Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Door F R, Dent(s), PDR - Paintless dent repair

122,40



Door R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Roof pillar R, Chemical polution, Acceptable

0,00

*No pictures to display*

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Roof, Dent(s), Acceptable

0,00

*No pictures to display*

Door R R, Scratch(es), Acceptable

0,00

*No pictures to display*

Rocker panel inner R R, Dent(s), Acceptable

0,00

*No pictures to display*