



VOLKSWAGEN TOURAN: 1KLX355

Vinnumber:	WVGZZZ1TZFW081576	Versionname:	1.6 CR TDI TRENDLINE BLUEMOTION TECH
First Registrationdate:	29/05/2015	Fiscalpower:	
Expertise Mileage:	105580	Power Kw:	77
Bodytype:	MPV	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2117
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3417,60
Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35

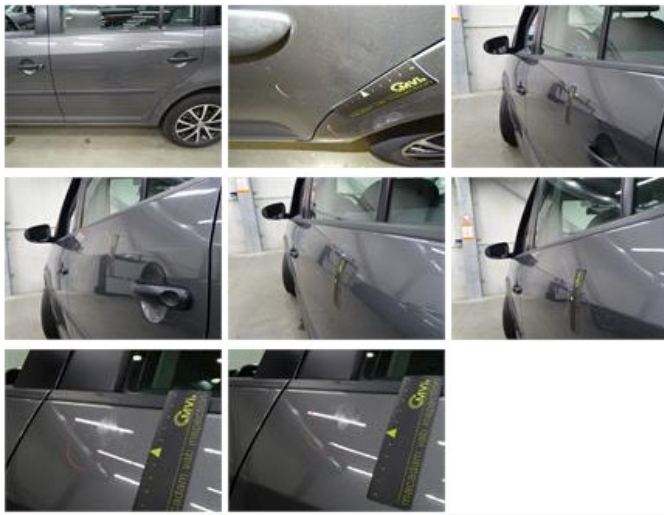

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Luggage space cover, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s), PDR - Paintless dent repair 63,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Sill outer L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Tailgate, Dent(s), LI - Repair and paint (complete) 301,68





Rear window, Scratch(es), E - Replace 0,00



Roof pillar R, Dent(s), Acceptable 0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair 110,64




Door panel R L, Tear, E - Replace 114,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50



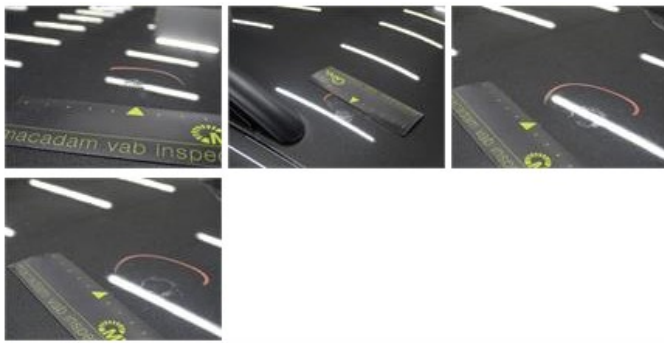

Rear spoiler, Chemical pollution, Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

