



**AUDI A6: 1GRP451**

Vinnumber:	<b>WAUZZZ4G8EN136005</b>	Versionname:	<b>A6 AVANT Multitr.177PK Aut.</b>
First Registrationdate:	<b>9/04/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>120075</b>	Power Kw:	<b>130</b>
Bodytype:	<b>Break</b>	Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1525</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>245/45/18/100 Y LightMetal</b>				
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT 2597,75

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Bad repair, Acceptable 0,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Repaired, Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), 67 - Polish 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Windscreen, Stone chip(s), E - Replace 0,00




Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16





Roof, Chemical polution, LI - Repair and paint (complete)

577,80

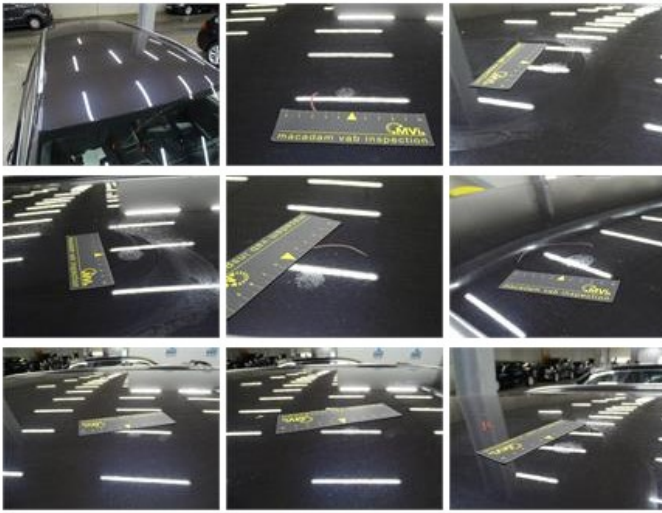

Wing F L, Scratch(es), LI - Repair and paint (complete)

264,21



Door R R, Chemical polution, LI - Repair and paint (complete)

382,02



Wing R R, Chemical polution, LI - Repair and paint (complete)

369,84





Door F L, Repaired, Acceptable 0,00

*No pictures to display*

Rearview mirror housing R, Scratch(es), Acceptable 0,00

*No pictures to display*

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Rear spoiler, Chemical pollution, LI - Repair and paint (complete) 115,56




Rear window, Scratch(es), Acceptable 0,00



Tailgate, Scratch(es), Acceptable 0,00

*No pictures to display*

Door R L, Bad repair, Acceptable 0,00

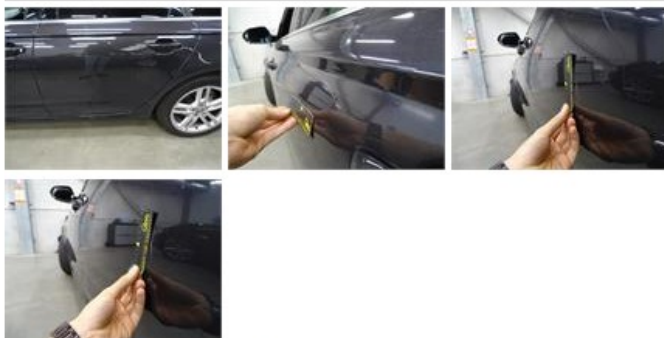

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00





Bonnet, Dent(s) and scratch(es), Acceptable

0,00

*No pictures to display*