



FORD KUGA: 1LDX967

Vinnumber:	WF0AXXWPMF583102	Versionname:	2.0 TDCI 2WD 88KW TREND
First Registrationdate:	1/09/2015	Fiscalpower:	
Expertise Mileage:	126035	Power Kw:	88
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4512
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

235/55/17/99 V LightMetal				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1065,68
Roof, Chemical polution, Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Scratch(es), LI - Repair and paint (complete)	382,02

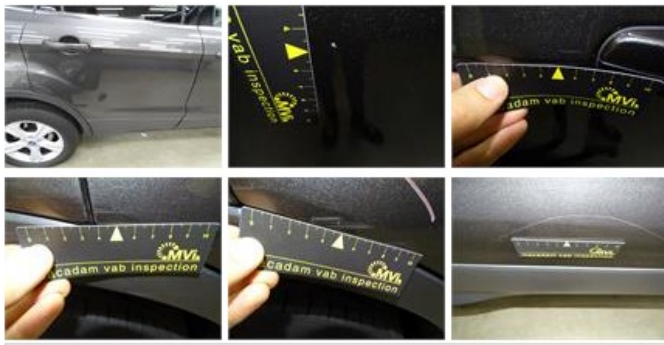

Wing F L, Bad repair, Acceptable

0,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R L, Dent(s), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Smart repair

110,64



Door F L, Dent(s), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper corner R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00





Wing trim R R, Scratch(es), E - Replace

96,00



Bonnet, Stone chip(s), Acceptable

0,00

No pictures to display