


OPEL Zafira: 1HRH941

Vinnumber:	W0LPE9E36F2001494	Versionname:	ZAFIRA TOURER ecoFL.Cosmo S/S 136PK
First Registrationdate:	12/09/2014	Fiscalpower:	
Expertise Mileage:	123049	Power Kw:	100
Bodytype:	MPV	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2102
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/95 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT		2097,27
Rearview mirror housing L, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Door F L, Scratch(es), LI - Repair and paint (complete)		318,35



Windscreen, Stone chip(s), Acceptable 0,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56






Roof, Chemical pollution, LI - Repair and paint (complete)

481,50



Floor covering F L, Hole, Smart repair

64,32

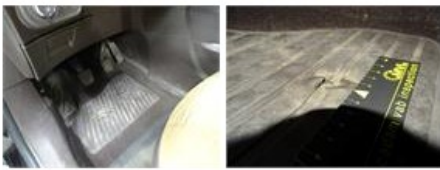

Interior, Dirty, Cleaning

50,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80





Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), 67 - Polish 0,00

No pictures to display

Door R R, Repaired, Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Chemical polution, Acceptable 0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

