



BMW 3 TOURING: 1LFJ013

Vinnumber:	WBA8J91030K424308	Versionname:	2.0 320D EFFICIENTDYN. (120KW) TOURING
First Registrationdate:	14/09/2015	Fiscalpower:	
Expertise Mileage:	157065	Power Kw:	120
Bodytype:	Break	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting LED
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 W LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1639,18
Bonnet, Scratch(es), 67 - Polish			0,00
<i>No pictures to display</i>			
Tailgate, Scratch(es), LI - Repair and paint (complete)			301,68



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Backrest cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Door panel F R, Scratch(es), E - Replace 114,00



Door panel R R, Scratch(es), E - Replace 114,00

No pictures to display


Centre console, Scratch(es), Acceptable 0,00

No pictures to display


Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

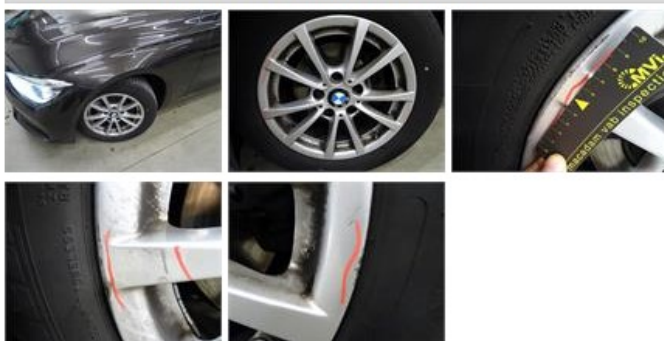

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

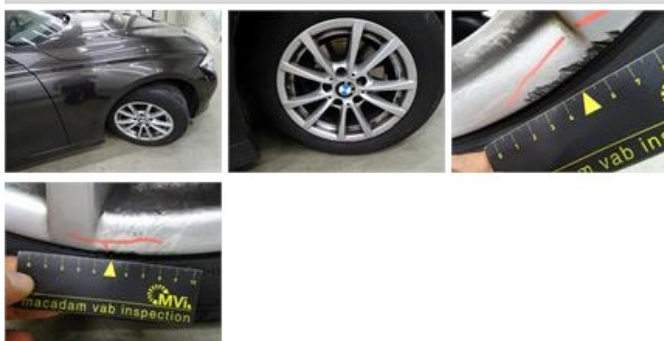

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Door frame R R, Scratch(es), It - Spot repair 115,56



Internal Boot Lining R, Scratch(es), Smart repair

110,64



Sill outer R, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Dent(s), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

481,50

