



**PEUGEOT 308 SW: 1LAS063**

Vinnumber:	<b>VF3LCBHXHFS126351</b>	Versionname:	<b>1.6 BLUEHDI 85KW S/S ACTIVE</b>
First Registrationdate:	<b>4/08/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>187446</b>	Power Kw:	<b>85</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3627</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/55/16/91 V LightMetal</b>				
Summer tyres:	Fr.L.	<b>Bridgestone: 4 mm</b>	Fr.R.	<b>Bridgestone: 3 mm</b>
	Re.L.	<b>Bridgestone: 4 mm</b>	Re.R.	<b>Bridgestone: 2 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT		2899,38
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)		95,00



Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Internal Boot Lining L, Broken, E - Replace

40,00



Wing F L, Chemical polution, LI - Repair and paint (complete)

220,18



Door F R, Repaired, Acceptable

0,00

No pictures to display

Wing F R, Chemical polution, LI - Repair and paint (complete)


220,18





Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

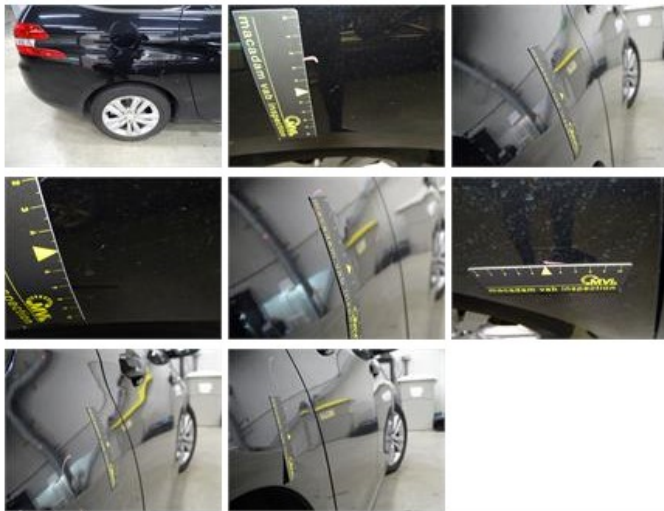

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Bad repair, Acceptable

0,00



Door F L, Scratch(es), Acceptable


0,00

No pictures to display

Rear window, Scratch(es), E - Replace

370,00



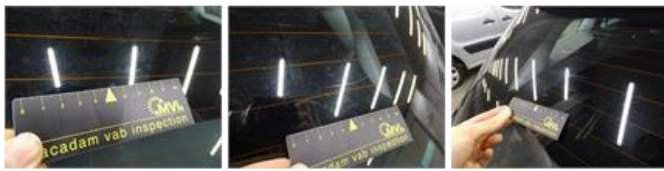

Windscreen, Scratch(es), Acceptable

0,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Roof, Chemical polution, LI - Repair and paint (complete)

481,50



A-pillar right, Chemical polution, LI - Repair and paint (complete)

165,64



Roof pillar L, Dent(s), Acceptable

0,00

*No pictures to display*

Door R L, Bad repair, Acceptable

0,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00

