



## SKODA Octavia: 1GVJ808

Vinnumber:	<b>TMBJG9NE6E0207976</b>	Versionname:	<b>OCTAVIA COMBI Ambition 105PK</b>
First Registrationdate:	<b>12/05/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>155279</b>	Power Kw:	<b>77</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metallic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3808</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>SD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>Tow bar removable</b>
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

## Limited Technical Inspection

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

## Degree of wear

<b>205/55/16/91 V LightMetal</b>				
Summer tyres:	Fr.L.	<b>Firestone: 4 mm</b>	Fr.R.	<b>Firestone: 4 mm</b>
	Re.L.	<b>Continental: 5 mm</b>	Re.R.	<b>Continental: 5 mm</b>

## Assistance equipment

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	3605,67
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Rear window, Scratch(es), E - Replace

370,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Door trim F R, Dent(s), E - Replace

114,00






Tailgate, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

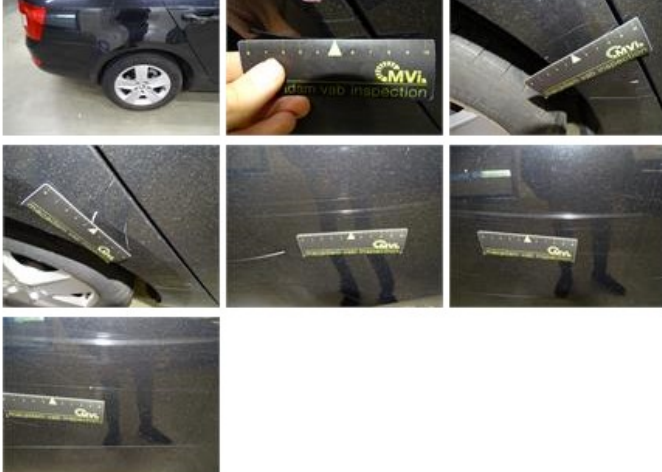

Door trim R R, Dent(s), E - Replace 114,00



Roof pillar L, Repaired, Acceptable 0,00

No pictures to display

Door R L, Scratch(es), LI - Repair and paint (complete) 318,35



Door F L, Dent(s), PDR - Paintless dent repair 82,80



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35

Door L, Scratch(es), LI - Repair and paint (complete)



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Rearlight R, Scratch(es), 67 - Polish

0,00



Roof pillar R, Repaired, Acceptable

0,00

No pictures to display


Door trim F L, Dent(s), Acceptable

0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18

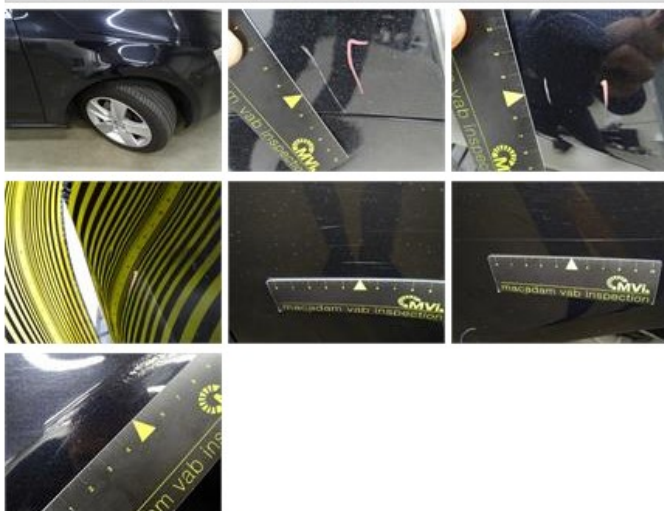

Door trim R L, Dent(s), E - Replace


114,00



Rear spoiler, Dent(s) and scratch(es), LI - Repair and paint (complete)

115,56



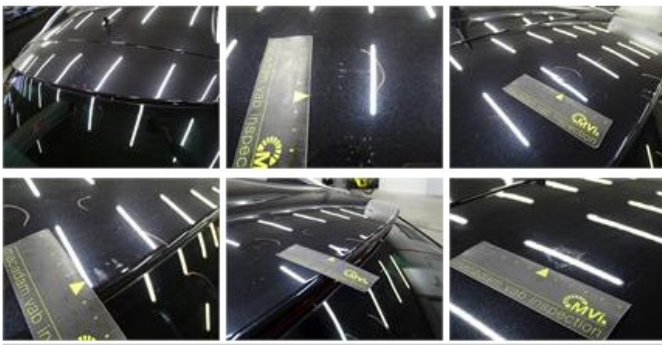

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), Acceptable 0,00

No pictures to display

Radio, Not functioning (well), Acceptable 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Windscreen, Repaired, Acceptable 0,00



Bonnet, Scratch(es), LI - Repair and paint (complete) 290,08

