



VOLKSWAGEN TOURAN: 1PKZ346

Vinnumber:	WVGZZZ1TZFW069290	Versionname:	1.6 CR TDI TRENDLINE BLUEMOTION TECH
First Registrationdate:	18/05/2015	Fiscalpower:	
Expertise Mileage:	135175	Power Kw:	77
Bodytype:	MPV	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1732
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	Tow bar removable
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Total cost ex VAT	1870,82
Roof rail L, Dent(s), Repair/replace (lump sum)	50,00



Bumper F, Scratch(es), LI - Repair and paint (complete)


211,80




Roof rail R, Dent(s), Repair/replace (lump sum) 50,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

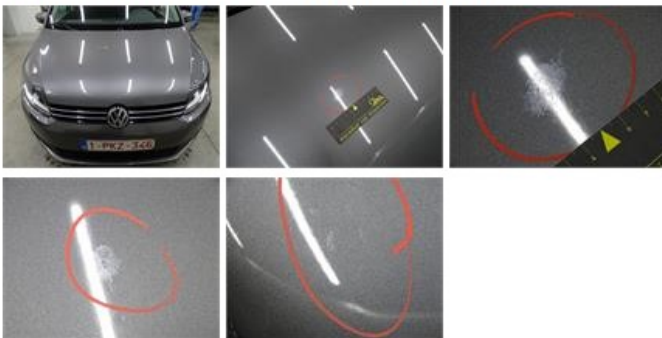

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00

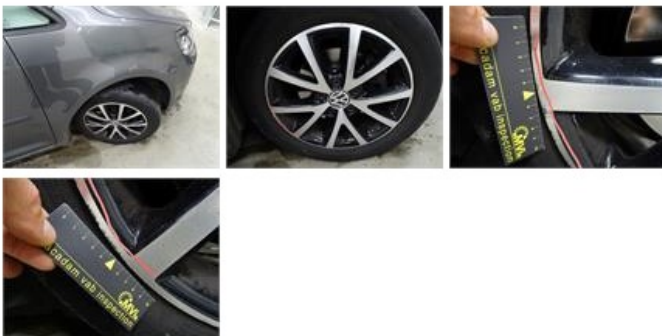

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair 110,64



Alloy rim R R polished, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Rear window, Scratch(es), E - Replace 370,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

