


RENAULT KADJAR: CX7455

Vinnumber:	VF1RFE00956182531	Versionname:	1.5 Energy dCi 110 EDC Bose? Edition
First Registrationdate:	14/10/2016	Fiscalpower:	
Expertise Mileage:	98209	Power Kw:	81
Bodytype:		Body color	Black
Gearbox:	Automatic	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3606
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options

GPS storage	HD	Seats electric F L	
GPS storage		Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	225/45/19/96 W LightMetal			
	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	4763,54
Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)	95,00



Rocker panel inner F R, Dent(s), LI - Repair and paint (complete)

115,56



Interior, Smell, Ozone treatment

152,58



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bumper corner R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing F R, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68




Door frame F L, Dent(s), It - Spot repair

115,56




Roof, Chemical polution, LI - Repair and paint (complete)

481,50

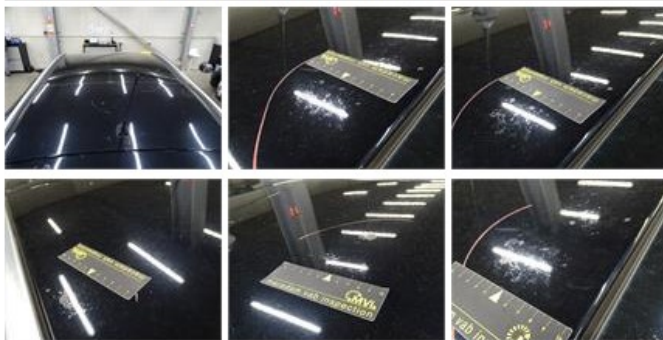


Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

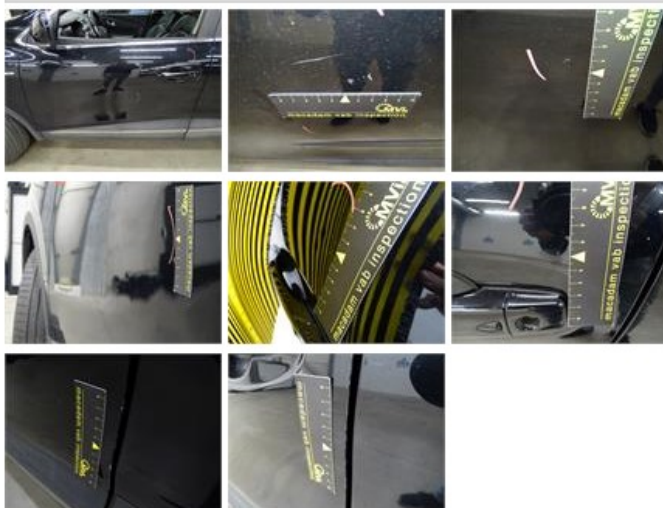

Roof pillar L, Chemical polution, LI - Repair and paint (complete)

220,18

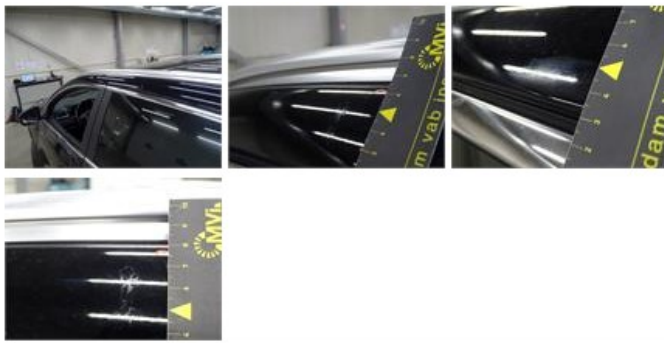

Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Covering interior A pillar L, Hole, E - Replace 51,61



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Chemical polution, 67 - Polish 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56



Roof pillar R, Chemical polution, LI - Repair and paint (complete) 220,18



Bumper R, Broken, E - Replace 415,20



Sunroof cover, Broken, E - Replace

889,56



Rear window, Scratch(es), Acceptable

0,00



Bonnet, Chemical polution, 67 - Polish

0,00

No pictures to display


Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Rear spoiler, Chemical polution, LI - Repair and paint (complete)

115,56

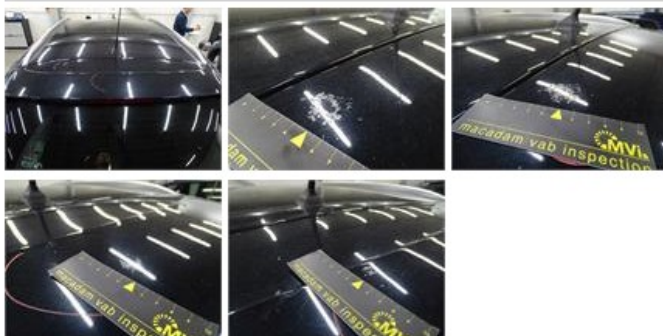

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable

0,00

No pictures to display