



BMW 2 ACTIVE TOURER: 1KSJ426

Vinnumber:	WBA2B31050V542116	Versionname:	1.5 216D ACTIVE TOURER
First Registrationdate:	23/06/2015	Fiscalpower:	
Expertise Mileage:	74700	Power Kw:	85
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	30000KM	Parking lot:	1106
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Winter tyres:	205/60/16/92 H LightMetal			
	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 3 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1991,20
-------------------	----------------

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

Door F R, Dent(s), PDR - Paintless dent repair	63,00
--	--------------



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Wing F R, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Tailgate, Scratch(es), Acceptable

0,00



Door F L, Dent(s) and scratch(es), Acceptable

0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35




Wing R R, Dent(s), Acceptable 0,00



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 100,00

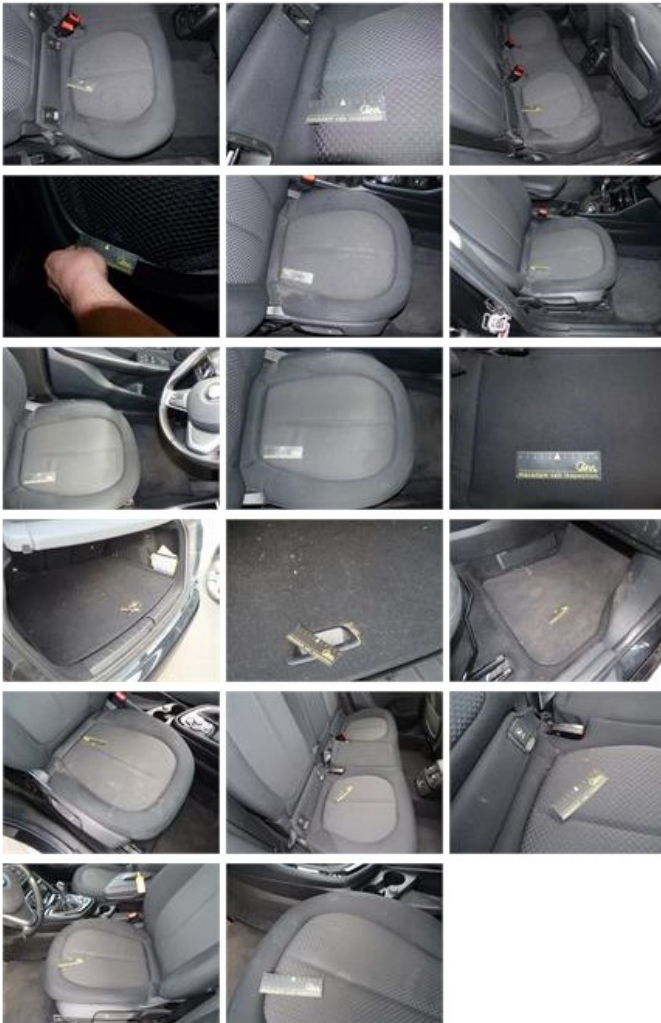

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Wing F R, Scratch(es), Acceptable 0,00



Alloy rim R R, Scratch(es), Acceptable 0,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00





Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20

