



PEUGEOT 3008: 1KR719

Vinnumber:	VF30UBHXMFS154376	Versionname:	1.6 BLUEHDI 85KW S&S BUSINESS LINE
First Registrationdate:	15/06/2015	Fiscalpower:	
Expertise Mileage:	109800	Power Kw:	85
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4329
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Rear parking sensors	
Cruise Control	Type of Tow bar	Tow bar removable
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/98 V Steel				
Summer tyres:	Fr.L.	Kleber: 5 mm	Fr.R.	Kleber: 5 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment

Total cost ex VAT	2334,96
Roof pillar R, Dent(s), LI - Repair and paint (complete)	220,18



Maintenance book, Missing, E - Replace	0,00
--	------

Wheel cover F R, Scratch(es), E - Replace

30,00



Wing F L, Chemical polution, LI - Repair and paint (complete)

220,18



Roof, Dent(s) and scratch(es), LI - Repair and paint (complete)

673,50




Wing R R, Dent(s), Acceptable

0,00

No pictures to display

Door F R, Dent(s), PDR - Paintless dent repair

82,80

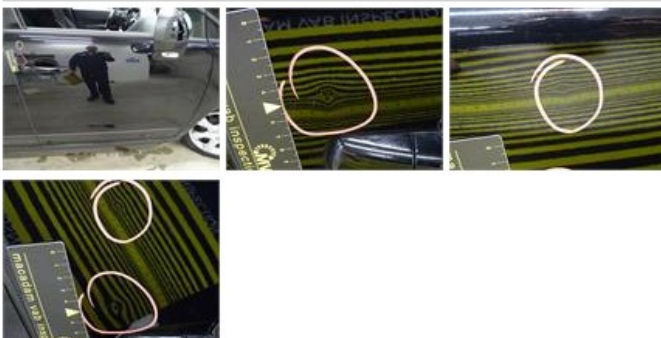


Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Door R L, Dent(s), PDR - Paintless dent repair

82,80

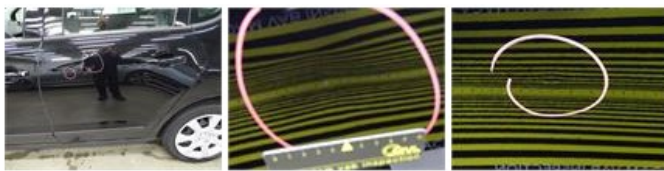

Bumper F, Scratch(es), Smart repair 110,64



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), 67 - Polish 0,00

No pictures to display

Ignition key, Missing, E - Replace 0,00



Instruction book, Missing, E - Replace 0,00

No pictures to display

Rearview mirror housing R, Missing, Le - Replace and paint 110,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar L, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18



Rear spoiler, Hail damage, PDR - Hail 0,00



Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), PDR - Paintless dent repair 82,80



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

