



VOLKSWAGEN POLO: 1KST063

Vinnnummer:	WVWZZZ6RZGY006749	Versionname:	1.4 TDI 55KW COMFORTLINE BMT
First Registrationdate:	24/06/2015	Fiscalpower:	
Expertise Mileage:	115903	Power Kw:	55
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1215
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	185/60/15/88 T Steel			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2241,06
Door R R, Repaired, Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Scratch(es), LI - Repair and paint (complete)	176,14



Ceiling, Hole, Smart repair

64,32



Door panel R L, Hole, Smart repair

110,64



Door F R, Deformed / Strained, Le - Replace and paint

0,00



Wheel cover F R, Scratch(es), Acceptable

0,00

No pictures to display

Door frame R L, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace

24,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

169,44



Bumper grille, Broken, E - Replace

30,72



Internal Boot Lining R, Scratch(es), Smart repair

110,64



Bumper R, Broken, Le - Replace and paint

535,20



Wing R L, Scratch(es), Acceptable

0,00

No pictures to display


Door R L, Scratch(es), 67 - Polish

0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete)

385,20

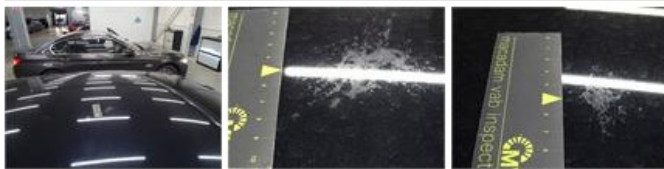

Wheel cover F L, Scratch(es), E - Replace

24,00



Tailgate, Dent(s), PDR - Paintless dent repair

63,00



Wing R R, Scratch(es), 67 - Polish

0,00



Sill outer R, Deformed / Strained, Le - Replace and paint

0,00



Wheel cover R R, Scratch(es), E - Replace

24,00



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

232,06



Foglight R, Scratch(es), Acceptable

0,00

No pictures to display



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

176,14