

AUDI A6: 1HRY443

Vinnumber:	WAUZZZ4G2EN191954	Versionname:	A6 AVANT 136PK
First Registrationdate:	17/09/2014	Fiscalpower:	
Expertise Mileage:	63376	Power Kw:	100
Bodytype:		Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3309
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/60/16/98 Y LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	3243,47
-------------------	----------------

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	0,00
---	-------------




Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09

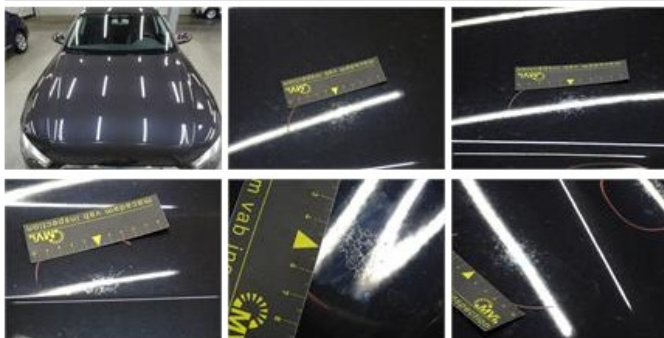

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16




Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56




Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 362,02



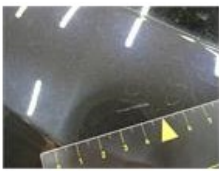

Roof, Chemical polution, LI - Repair and paint (complete)

577,80

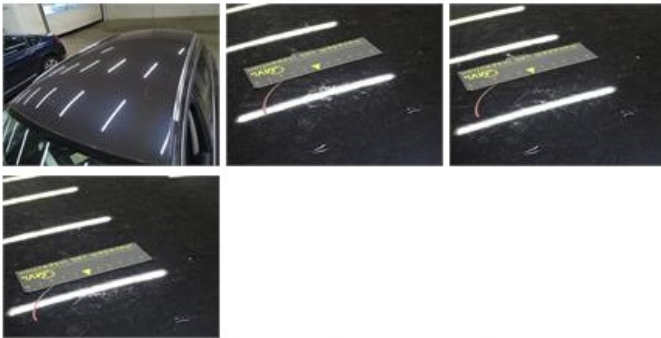

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

264,21



Door R R, Scratch(es), LI - Repair and paint (complete)

382,02



Wing R L, Scratch(es), LI - Repair and paint (complete)

369,84



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Wing F L, Scratch(es), LI - Repair and paint (complete) 264,21

