



BMW 1 HATCH: 1LHC917

Vinnumber:	WBA1V910005B19839	Versionname:	1.5 116D EFFICIENTDYNAMICS EDIT. (85KW)
First Registrationdate:	28/09/2015	Fiscalpower:	
Expertise Mileage:	155193	Power Kw:	85
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2602
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2711,23

Wing F R, Dent(s), PDR - Paintless dent repair 63,00



Interior, Dirty, Cleaning

25,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Rear window, Scratch(es), Acceptable

0,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

332,20



Bonnet, Scratch(es), 67 - Polish

0,00

No pictures to display

Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wheel hub cap R R, Missing, E - Replace

20,00



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Dent(s), PDR - Paintless dent repair

142,20



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00





Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Ignition key, Missing, E - Replace 150,00

No pictures to display


Tailgate, Scratch(es), 67 - Polish 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80

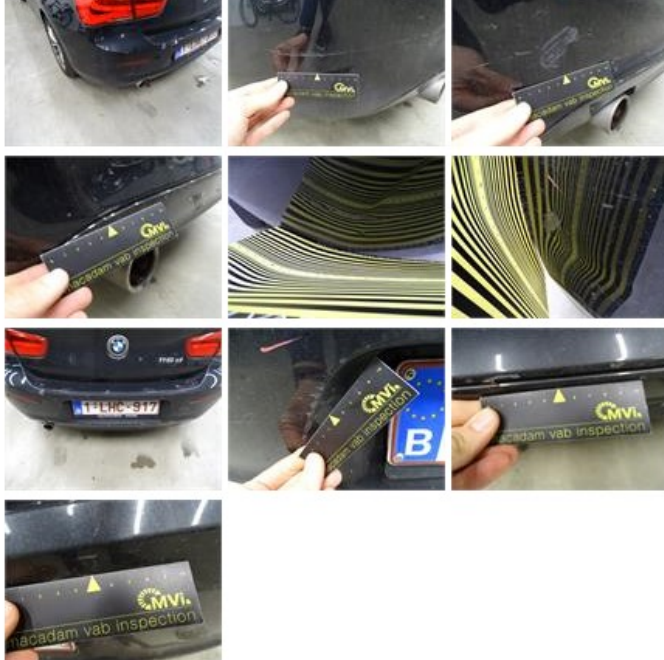

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

