



AUDI A4 AVANT: 1LHG590

Vinnumber:	WAUZZZ8K6FA162237	Versionname:	2.0 TDI ULTRA 100KW
First Registrationdate:	29/09/2015	Fiscalpower:	
Expertise Mileage:	141462	Power Kw:	100
Bodytype:		Body color	Light Grey
Gearbox:	MAN 6 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3631
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage	DVD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	205/60/16/96 V LightMetal			
	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 4 mm	Re.R.	Uniroyal: 4 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2144,29
Windscreen, Stone chip(s), Windscreen repair	0,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35




Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper grille, Missing, E - Replace 32,40



Door F L, Dent(s), PDR - Paintless dent repair 63,00

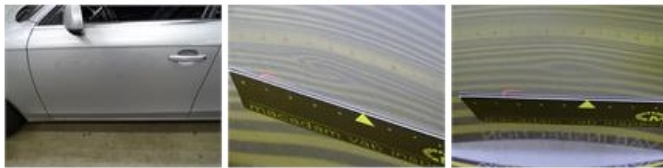

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80





Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80




Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50

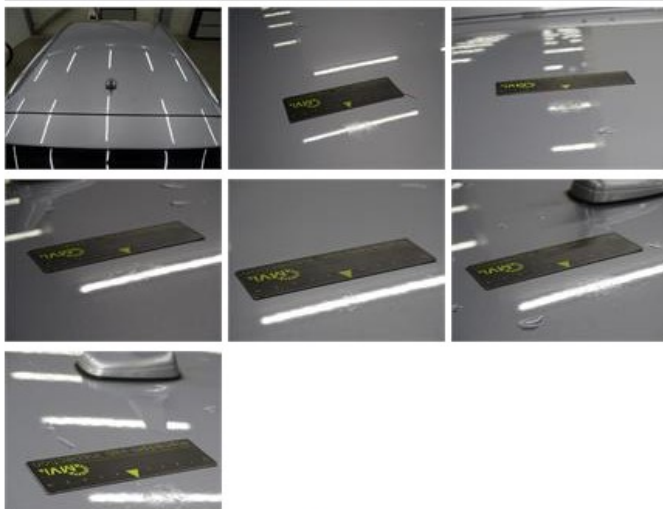

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18




Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

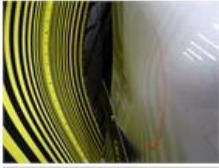

Rear window, Scratch(es), E - Replace

0,00

