



VOLKSWAGEN GOLF VII: 1LKD710

Vinnumber:	WVWZZZAUZGP045749	Versionname:	1.6 TDI 81KW TRENDLINE
First Registrationdate:	9/10/2015	Fiscalpower:	
Expertise Mileage:	67495	Power Kw:	81
Bodytype:		Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1704
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 H Steel			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 3466,35

Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wheel cover R R, Scratch(es), E - Replace

30,00



Tailgate, Chemical pollution, LI - Repair and paint (complete)

301,68



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)

115,56



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50



Wheel cover F R, Scratch(es), E - Replace

30,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18



Door R L, Chemical pollution, 67 - Polish

0,00

No pictures to display

Wing F L, Scratch(es), 67 - Polish

0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Rear spoiler, Chemical polution, 67 - Polish 0,00

No pictures to display


Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

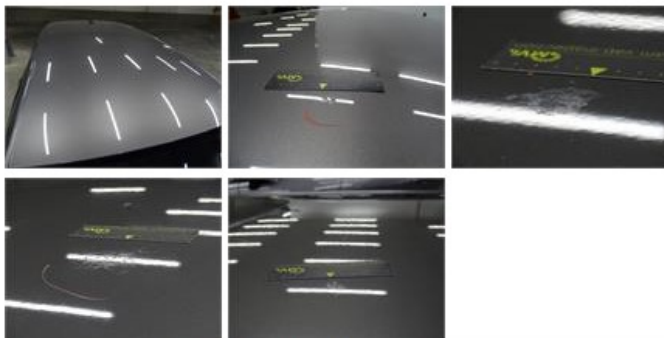

Covering interior A pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), 67 - Polish 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



