


AUDI A6: 1HYU794

Vinnumber:	WAUZZZ4G6EN197630	Versionname:	A6 AVANT Ultra 190PK
First Registrationdate:	31/10/2014	Fiscalpower:	
Expertise Mileage:	132254	Power Kw:	140
Bodytype:		Body color:	Dark Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2720
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage		Seats electric F R	
GPS storage	HD	Sun Roof electric	
Windows electric F		Panoramic roof	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/55/17/97 H LightMetal			
Winter tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Vredestein: 7 mm	Re.R.	Vredestein: 7 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT 3986,93

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), Acceptable 0,00




Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00




Ignition key, Missing, E - Replace 150,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84

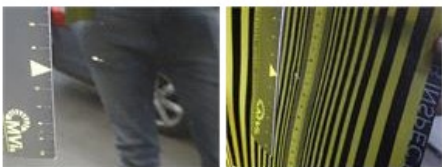

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84

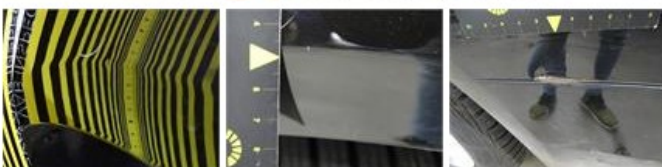

TV DVD screen, Incomplete, P - Check 0,00






Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 577,80

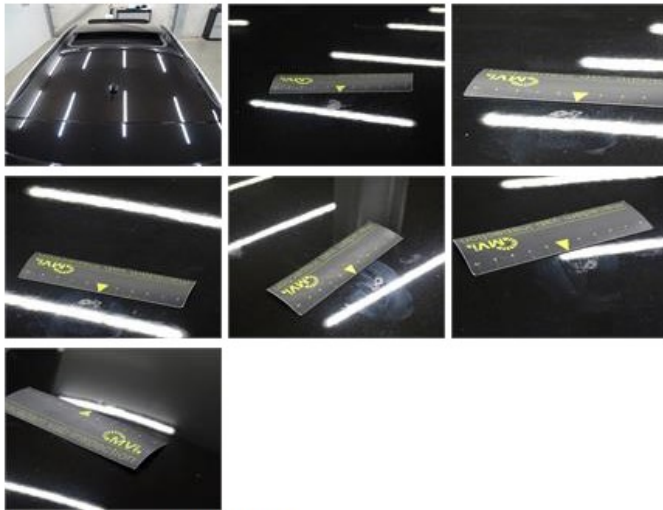


Rear spoiler, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 372,60

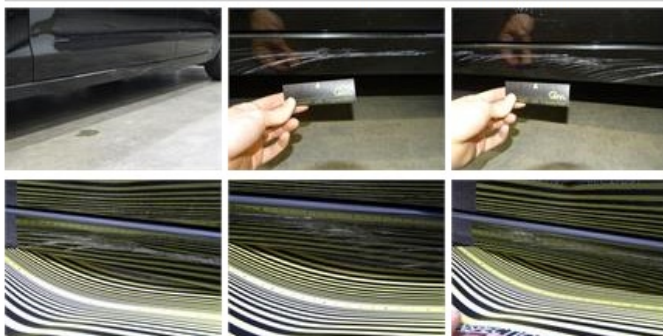

Wing F L, Scratch(es), LI - Repair and paint (complete) 264,21



Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Rear window, Scratch(es), E - Replace 0,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 264,21



Bonnet, Scratch(es), LI - Repair and paint (complete) 348,09



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02

