



VOLVO V60: 1HSV784

Vinnumber:	VV1FW31A1F1234208	Versionname:	V60 BRE D3 Kinetic 136PK
First Registrationdate:	24/09/2014	Fiscalpower:	
Expertise Mileage:	131158	Power Kw:	100
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2325
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Autom climate control		
Sport seats			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

235/40/18/95 V LightMetal				
Winter tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Kleber: 4 mm	Re.R.	Kleber: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2984,64
Roof, Chemical polution, LI - Repair and paint (complete)	481,50

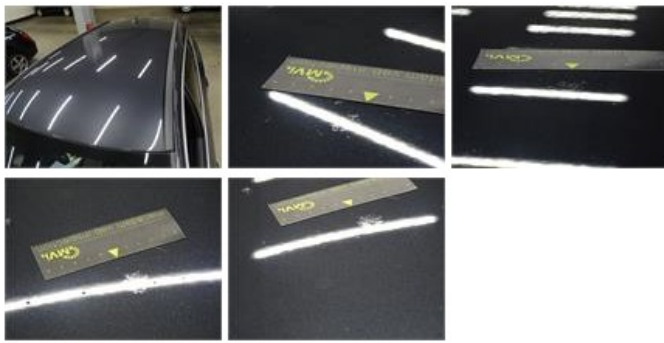

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door frame R R, Dent(s), It - Spot repair 115,56



Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56



Rear spoiler, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), F - Replace 0,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Door panel R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Chemical pollution, 67 - Polish 0,00

No pictures to display

Spoiler R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Sill outer R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Door frame R L, Dent(s), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door panel R R, Scratch(es), Smart repair 110,64



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56





Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

290,08

