



OPEL INSIGNIA SPORTS TOURER: 1LJY360

Vinnumber:	WOLGT8E37G1008249	Versionname:	1.6 CDTI ECOFLEX 100KW S/S COSMO
First Registrationdate:	8/10/2015	Fiscalpower:	
Expertise Mileage:	133194	Power Kw:	100
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3215
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Sun Roof electric	
GPS storage	HD	Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/101 V LightMetal				
Winter tyres:	Fr.L.	Vredestein: 6 mm	Fr.R.	Vredestein: 6 mm
	Re.L.	Kleber: 7 mm	Re.R.	Kleber: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT 2111,67

Windscreen, Scratch(es), Acceptable 0,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

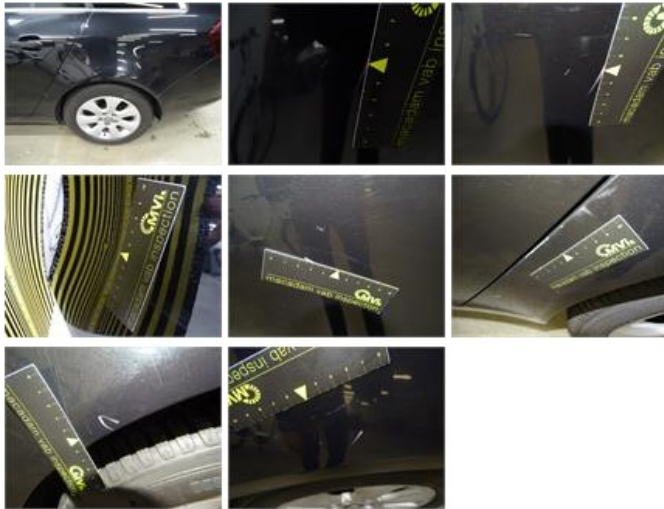

Roof, Chemical polution, 67 - Polish

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display


Protection plate M, Deformed / Strained, E - Replace

74,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

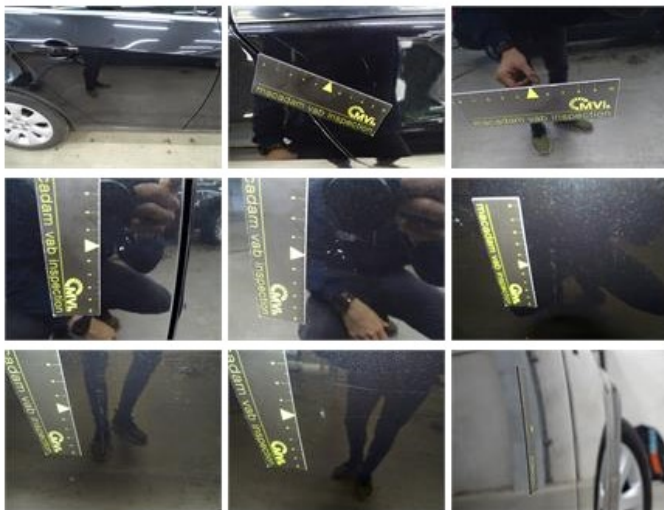

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80





Bonnet, Bad repair, Acceptable 0,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Floor covering F L, Hole, Smart repair 64,32



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 370,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20





Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing F R, Scratch(es), Acceptable

0,00

No pictures to display