



AUDI A1 SPORTBACK: 1LUA591

Vinnumber:	WAUZZZ8XXGB060656	Versionname:	1.0 TFSI ULTRA 70KW DESIGN
First Registrationdate:	4/12/2015	Fiscalpower:	
Expertise Mileage:	38697	Power Kw:	70
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2117
Number of doors:	5		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage	SD	Rear parking sensors	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/45/16/90 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 1383,36

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display
Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 246,56



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

176,14



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

169,44



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00




Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

0,00

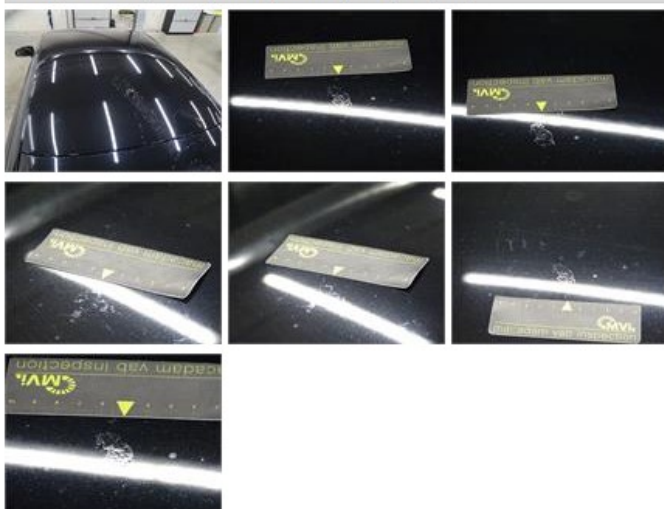

Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper grille, Dent(s), E - Replace 30,72



Protection plate M, Deformed / Strained, E - Replace 74,00




Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Deformed / Strained, LI - Repair and paint (complete) 232,06

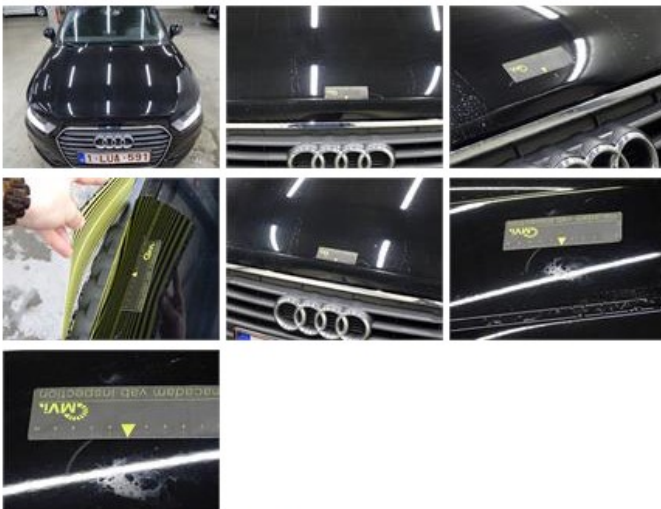

Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 169,44



