



**BMW 3: 1HXH647**

Vinnumber:	<b>WBA3K11050F836117</b>	Versionname:	<b>3 TOURING 318d 136PK</b>
First Registrationdate:	<b>21/10/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>108397</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2820</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>Tow bar fixed</b>
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

	<b>205/60/16/92 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

<b>Total cost ex VAT</b>	<b>3142,84</b>
<b>Wing F R, Scratch(es), Acceptable</b>	<b>0,00</b>
<i>No pictures to display</i>	
<b>Bonnet, Chemical polution, LI - Repair and paint (complete)</b>	<b>290,08</b>

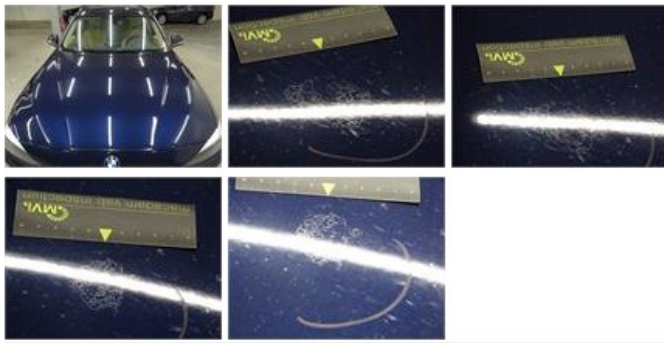

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door panel R R, Tear, E - Replace

114,00



Rearview mirror housing L, Scratch(es), 67 - Polish

0,00

*No pictures to display*

Door F L, Dent(s) and scratch(es), Acceptable

0,00

*No pictures to display*

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80







Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35




Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Seat cover F L, Worn, Acceptable 0,00



Roof, Scratch(es), LI - Repair and paint (complete) 481,50

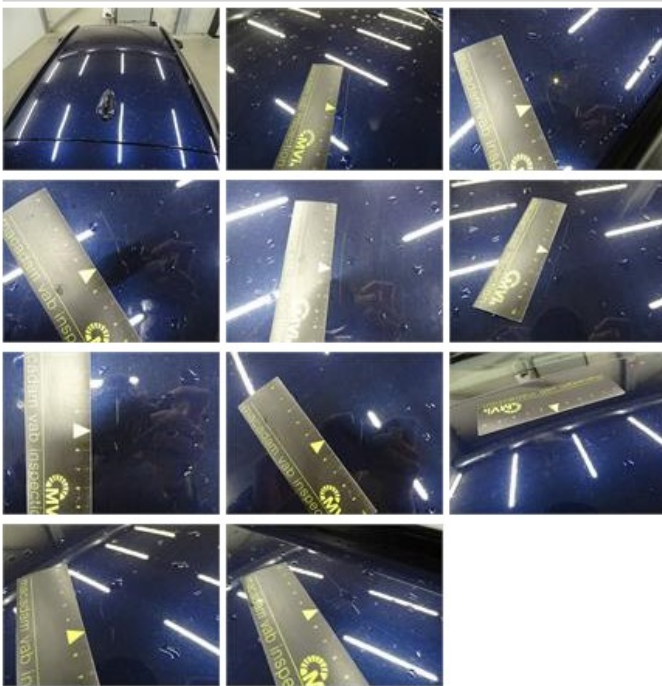

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Dashboard, Scratch(es), Acceptable 0,00



Covering interior B pillar L, Worn, Acceptable

0,00



Rear window, Scratch(es), E - Replace

370,00



Wing F L, Scratch(es), 67 - Polish

0,00

*No pictures to display*

Door R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door panel F L, Worn, Acceptable

0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

