



BMW 4 GRAN COUPE: 1LXZ037

Vinnumber:	WBA4E71010G519170	Versionname:	2.0 418D (110KW) GRAN COUPE
First Registrationdate:	31/12/2015	Fiscalpower:	
Expertise Mileage:	112936	Power Kw:	110
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LKW2
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2059,46
--------------------------	----------------

Windscreen, Stone chip(s), Acceptable	0,00
--	-------------




Boot cover, Missing, E - Replace 60,00



Wheel hub cap F L, Missing, E - Replace 20,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

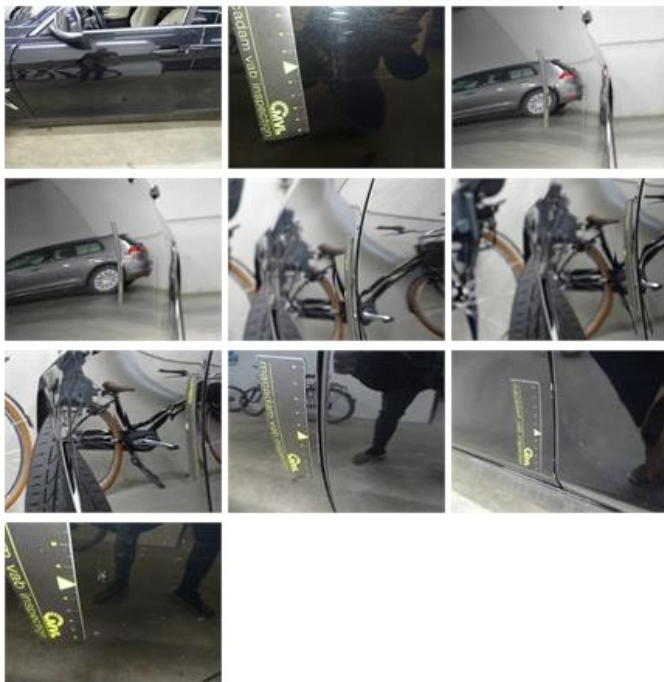

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00




Sill outer R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

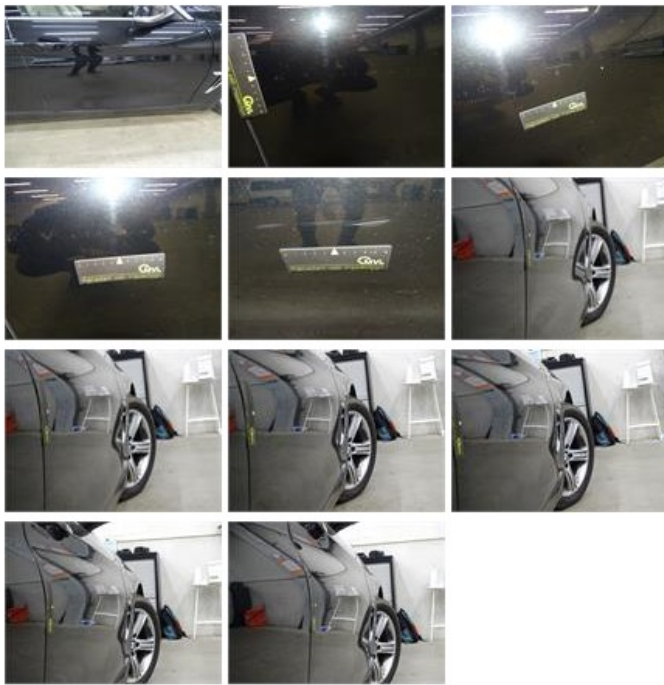

Tailgate, Chemical pollution, 67 - Polish 0,00

No pictures to display

Backrest cover F L, Worn, Acceptable 0,00




Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84

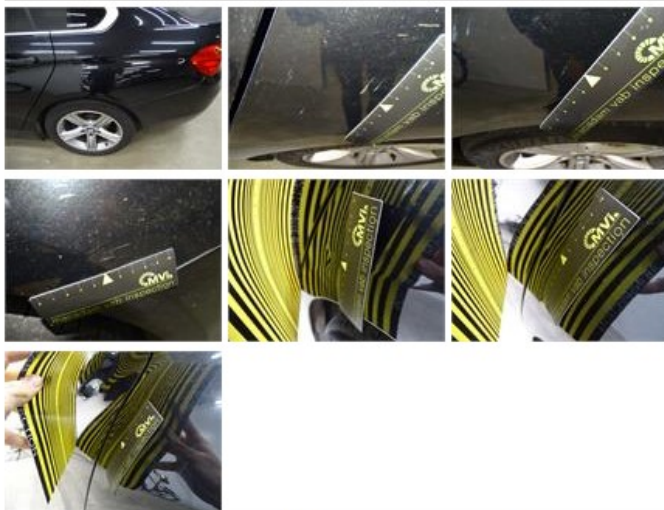

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02





Door R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, 67 - Polish 0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Roof, Dent(s), PDR - Paintless dent repair 63,00

