


SKODA OCTAVIA COMBI: 1PSY881

Vinnumber:	TMBJG7NE0H0059672	Versionname:	1.6 CRTDI 81KW GREENLINE AMBITION
First Registrationdate:	9/09/2016	Fiscalpower:	
Expertise Mileage:	146834	Power Kw:	81
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	PARKING A12
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Uniroyal: 4 mm	Fr.R.	Uniroyal: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	4278,36
Wing R L, Dent(s), PDR - Paintless dent repair	102,60




Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

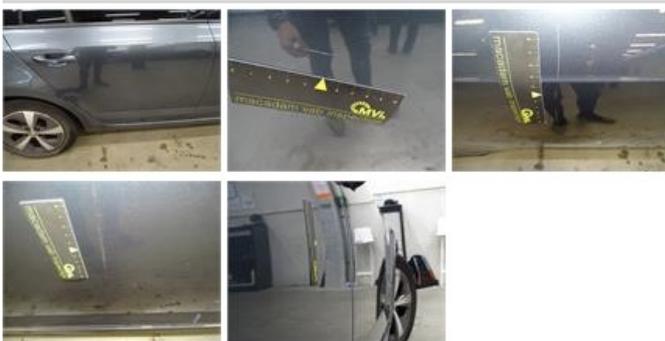

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar L, Chemical polution, LI - Repair and paint (complete) 220,18



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable

0,00

No pictures to display

Rear spoiler, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

481,50



Backrest cover F L, Worn, Acceptable

0,00



Alloy rim F L polished, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Trunk lid covering R, Scratch(es), Smart repair

110,64



Wing F R, Scratch(es), LI - Repair and paint (complete)

220,18




Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

301,68



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

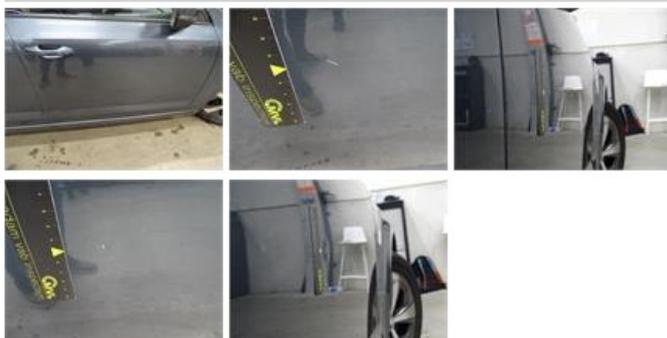

Roof pillar R, Dent(s), Acceptable

0,00

No pictures to display

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56



Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18

