



VOLKSWAGEN TOURAN: 1KPD257

Vinnumber:	WVGZZZ1TZFW081887	Versionname:	1.6 CR TDI TRENDLINE BLUEMOTION TECH
First Registrationdate:	8/06/2015	Fiscalpower:	
Expertise Mileage:	95915	Power Kw:	77
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3413
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Panoramic roof	
GPS storage	HD	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	869,24
Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Seat cover F L, Stain, Cleaning

25,00



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Trunk lid covering R, Scratch(es), Smart repair

110,64



Door R L, Dent(s) and scratch(es), Acceptable

0,00


No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Windscreen, Scratch(es), Acceptable 0,00

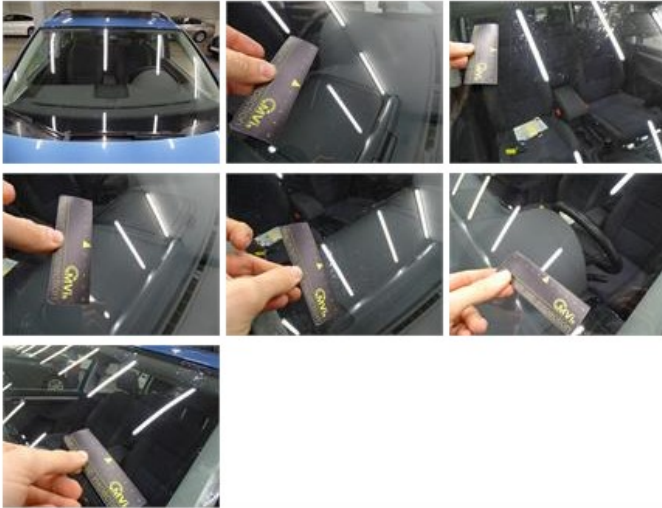

Tailgate, Dent(s), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, 67 - Polish 0,00



Central pillar L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Chemical polution, 67 - Polish 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F R, Stain, Cleaning 25,00

