



BMW 3: 1FLQ787

Vinnumber:	WBA3K11010F825289	Versionname:	3 TOURING 318d 136PK
First Registrationdate:	8/08/2013	Fiscalpower:	
Expertise Mileage:	189808	Power Kw:	100
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	4307
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/98 V LightMetal				
Summer tyres:	Fr.L.	Other: 6 mm	Fr.R.	Other: 6 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment

Runflat	Yes
---------	------------

Total cost ex VAT	2916,79
-------------------	----------------

Interior, Dirty, Cleaning	24,00
---------------------------	--------------



Maintenance, Maintenance, Execute 0,00



Windscreen, Crack, E - Replace 0,00



Door F L, Dent(s), PDR - Paintless dent repair 63,00



Spoiler R, Scratch(es), It - Spot repair 115,56



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Tyre F R, Deformed / Strained, E - Replace 132,00



Wing F R, Rust, LI - Repair and paint (complete) 220,18



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Deformed / Strained, E - Replace 415,20




Tyre F L, Not original part, Acceptable 0,00



Door F R, Scratch(es), LI - Repair and paint (complete)

0,00

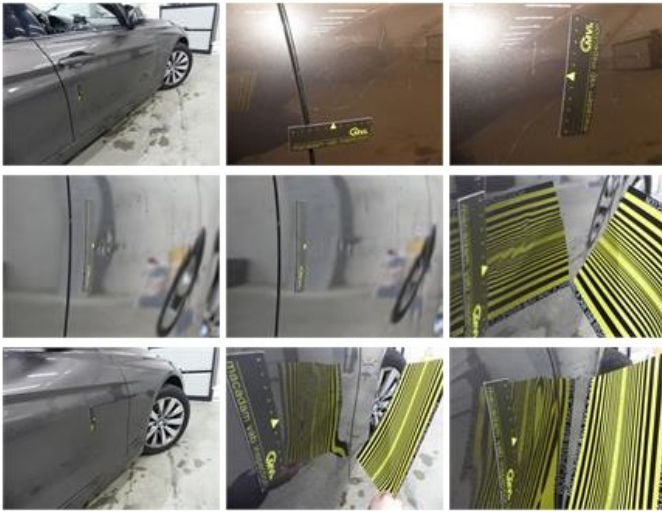

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Dent(s), PDR - Paintless dent repair

63,00



Bumper F, Deformed / Strained, Le - Replace and paint

735,00



Foglight R, Broken, E - Replace

138,00



Rocker panel inner R R, Dent(s), LI - Repair and paint (partial)

115,00



Roof, Chemical polution, LI - Repair and paint (complete)

481,50

